

City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

Holmes Run Condition Assessment

PREPARED FOR: City of Alexandria, CH2M Hill
PREPARED BY: Baker
DATE: March 20, 2013 (Revised May 26, 2015)

Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Holmes Run was completed. In total, 506 storm sewer structures were inspected, including 231 manholes, 236 inlets, 38 I/O structures, and one node. In addition, 964 storm sewer pipe segments were inspected. This Technical Memorandum describes the results of the field investigations in the Holmes Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at a storm structure and quickly screen the structure and its connecting pipes for defects. The technique is considered a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Holmes Run as part of the CASSCA project, but only for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (approximately 1%) of the total storm infrastructure length in Holmes Run. The results of these inspections will be provided in a separate Memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established for different conditions of sewer facilities along with corresponding ranges for each defect category in SCREAM. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating. For example, a pipe may have several small cracks which would rate the asset in the medium category but if it had a section that was collapsed, it would fall in the extreme category.

Table 1 – SCREAM Defect Categories

| Defect Category | Score Range | Example |
|-----------------|-------------|--|
| None | 0 | n/a |
| Few | 1-20 | Infiltration weeper |
| Minimum | 21-40 | Manhole cracks less than 1/8" |
| Moderate | 41-60 | Spalling of chamber wall, large infiltration flow |
| Major | 61-80 | Large cracks in cover or frame |
| Extreme | 81-100 | Collapsed Pipe |

Structure Inspections

Figure 1 is a summary of the inspection results by severity of structure condition score. Figure 2 is provided to show the location of each structure within the Holmes Run watershed, color coded to the defect categories listed above. The average condition score of 506 storm structures inspected within the Holmes Run watershed was 45 (Moderate). Six (6) structures had scores 81 or higher, placing them in the major and extreme categories. About 13% of the structures showed few to no defects, while the remaining 71% of structures ranked in the minimum to moderate defect categories.

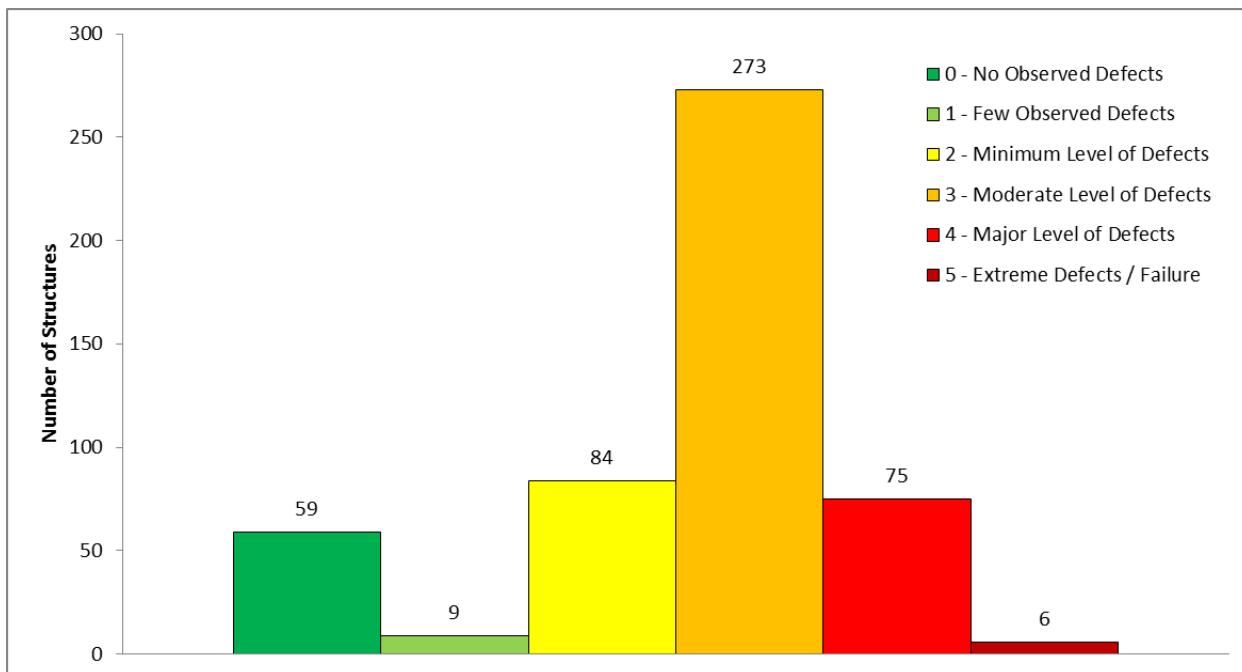


Figure 1. Structure Inspection Summary.

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).


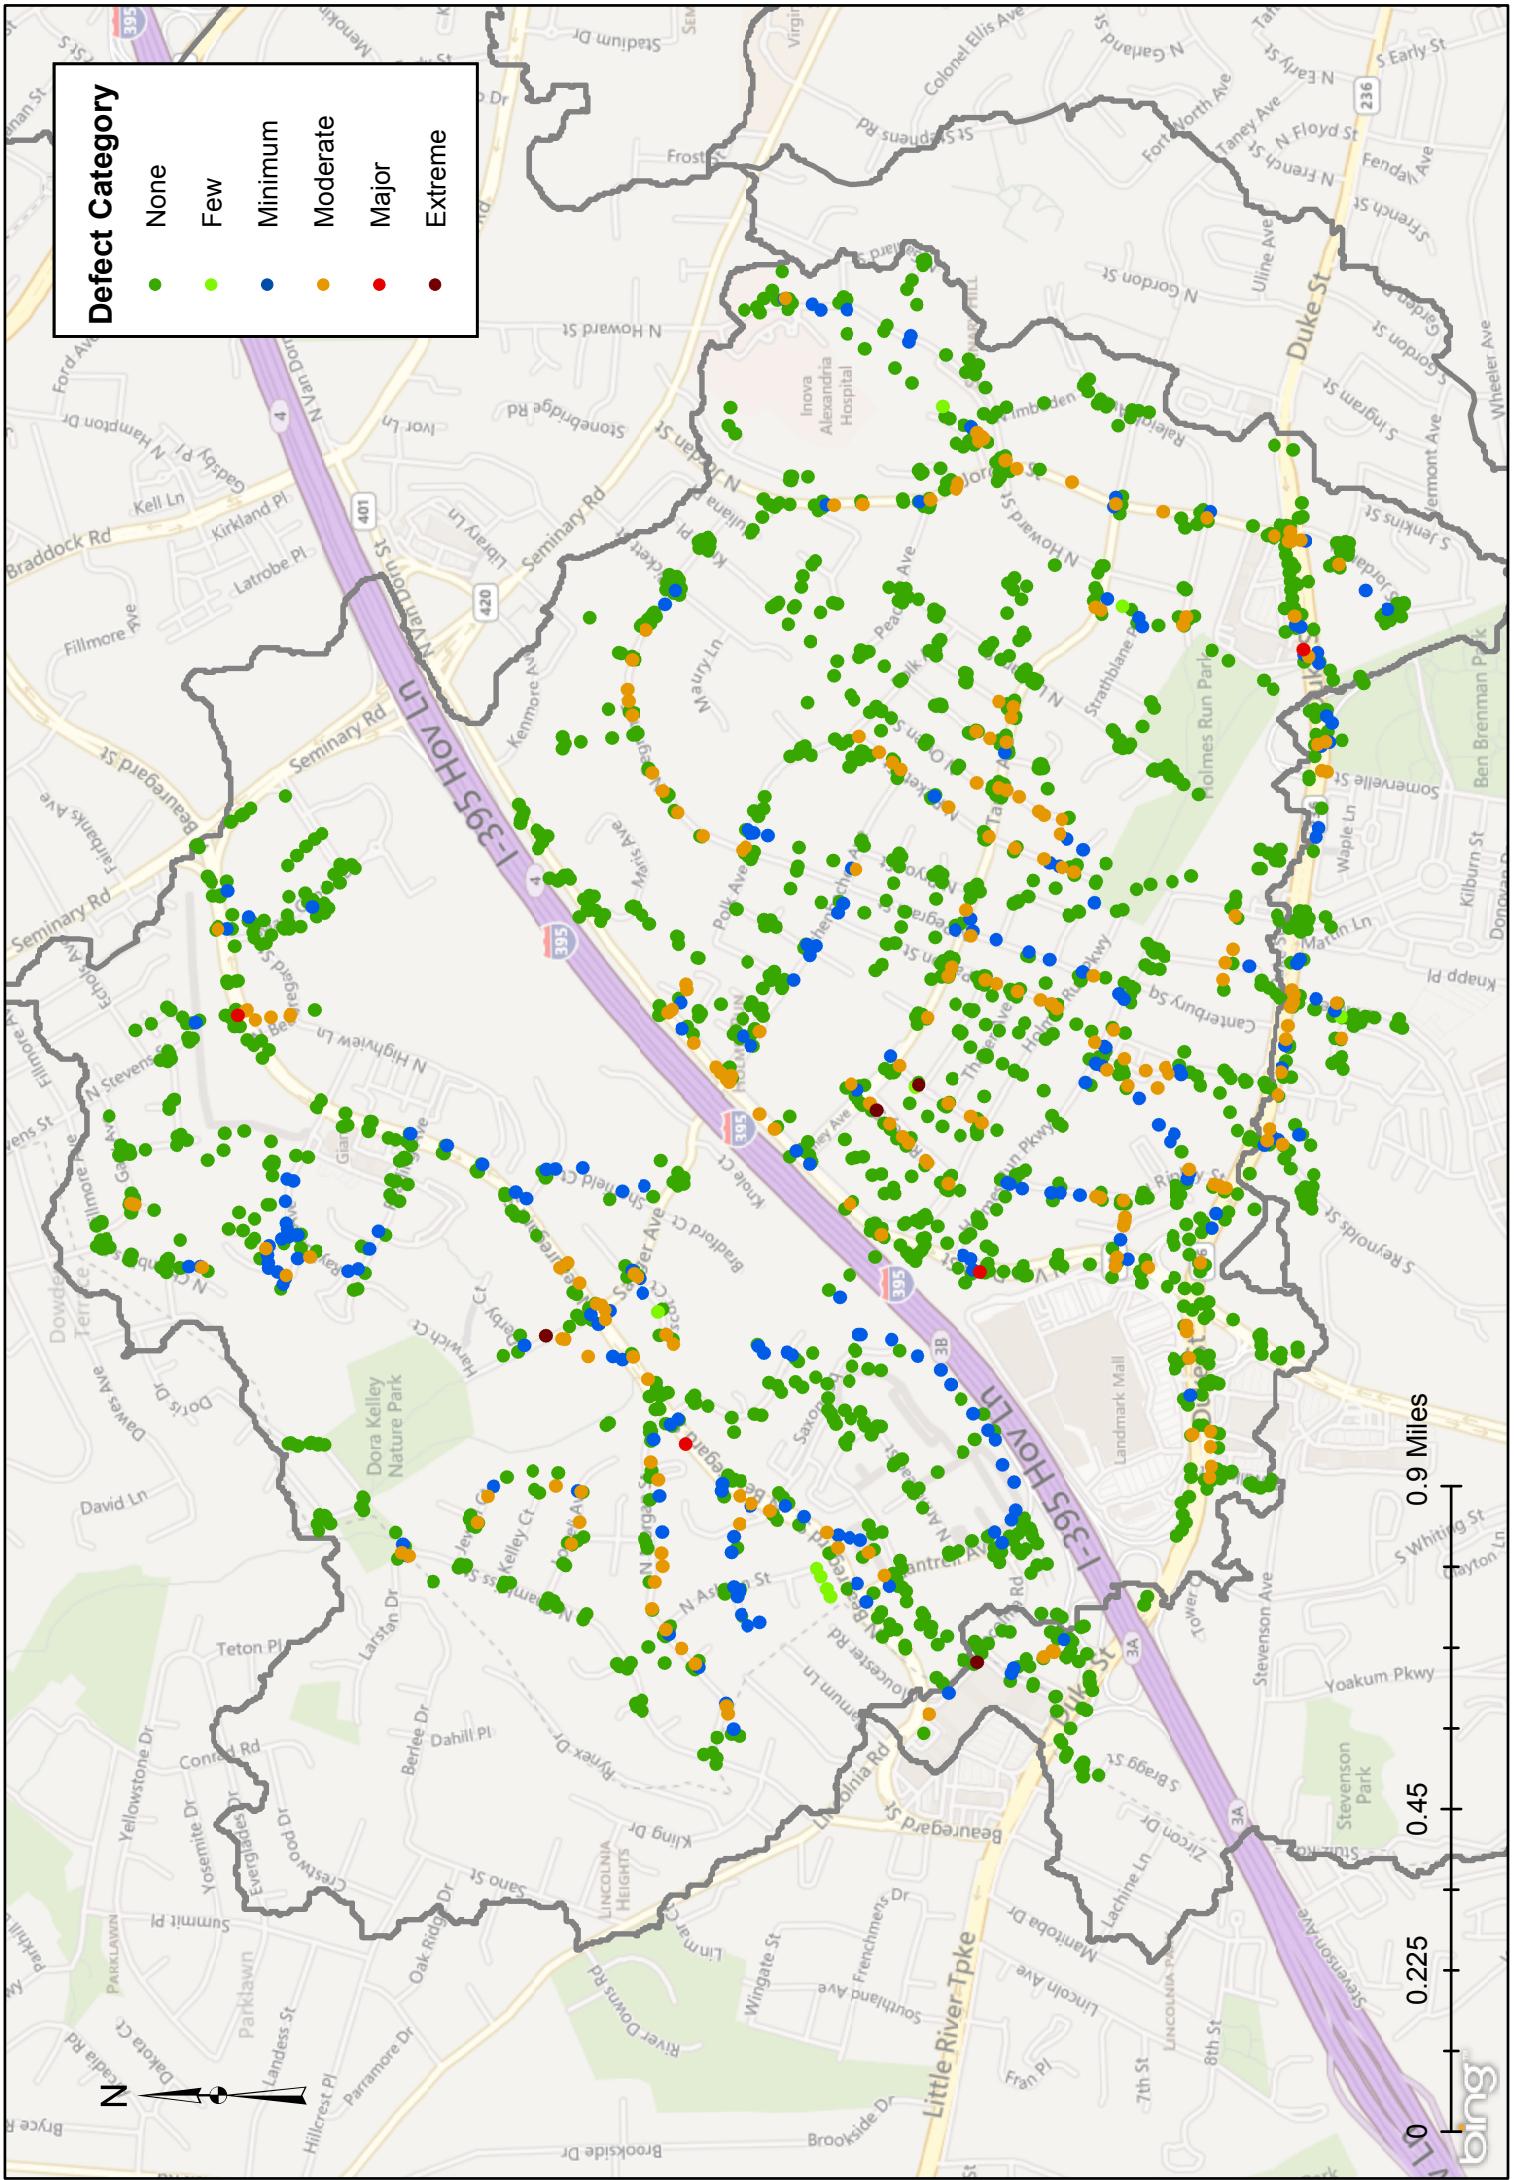


Figure 3 displays the location of the structures classified with major and extreme damage only. The structures with high defect scores are mainly distributed along N Beauregard Street and Taney Avenue on both sides of I-395. The inspections of the structures were broken down by structure component for further detailed condition assessment. Table 2 lists the number of observed defects, by component and severity. The table shows a count of the number of defects found in each component and their respective severity; not the number of inspections performed. Multiple defects may be found in a single component of a structure.

Table 2 - Count of Structure Inspection Observations by MH Component and Severity

| Structure Component | Min | Mod | Maj | Extreme |
|---------------------|------|-----|-----|---------|
| Cover | 0 | 0 | 0 | 4 |
| Frame | 8 | 5 | 0 | 0 |
| Frame Base Seal | 497 | 74 | 12 | 4 |
| Chimney/Shft | 545 | 62 | 4 | 0 |
| Chamber | 1162 | 112 | 3 | 0 |
| Bench | 36 | 11 | 6 | 2 |
| Steps | 6 | 2 | 0 | 0 |
| Channel | 22 | 26 | 16 | 2 |
| Pipe Connection | 27 | 20 | 5 | 2 |

Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).

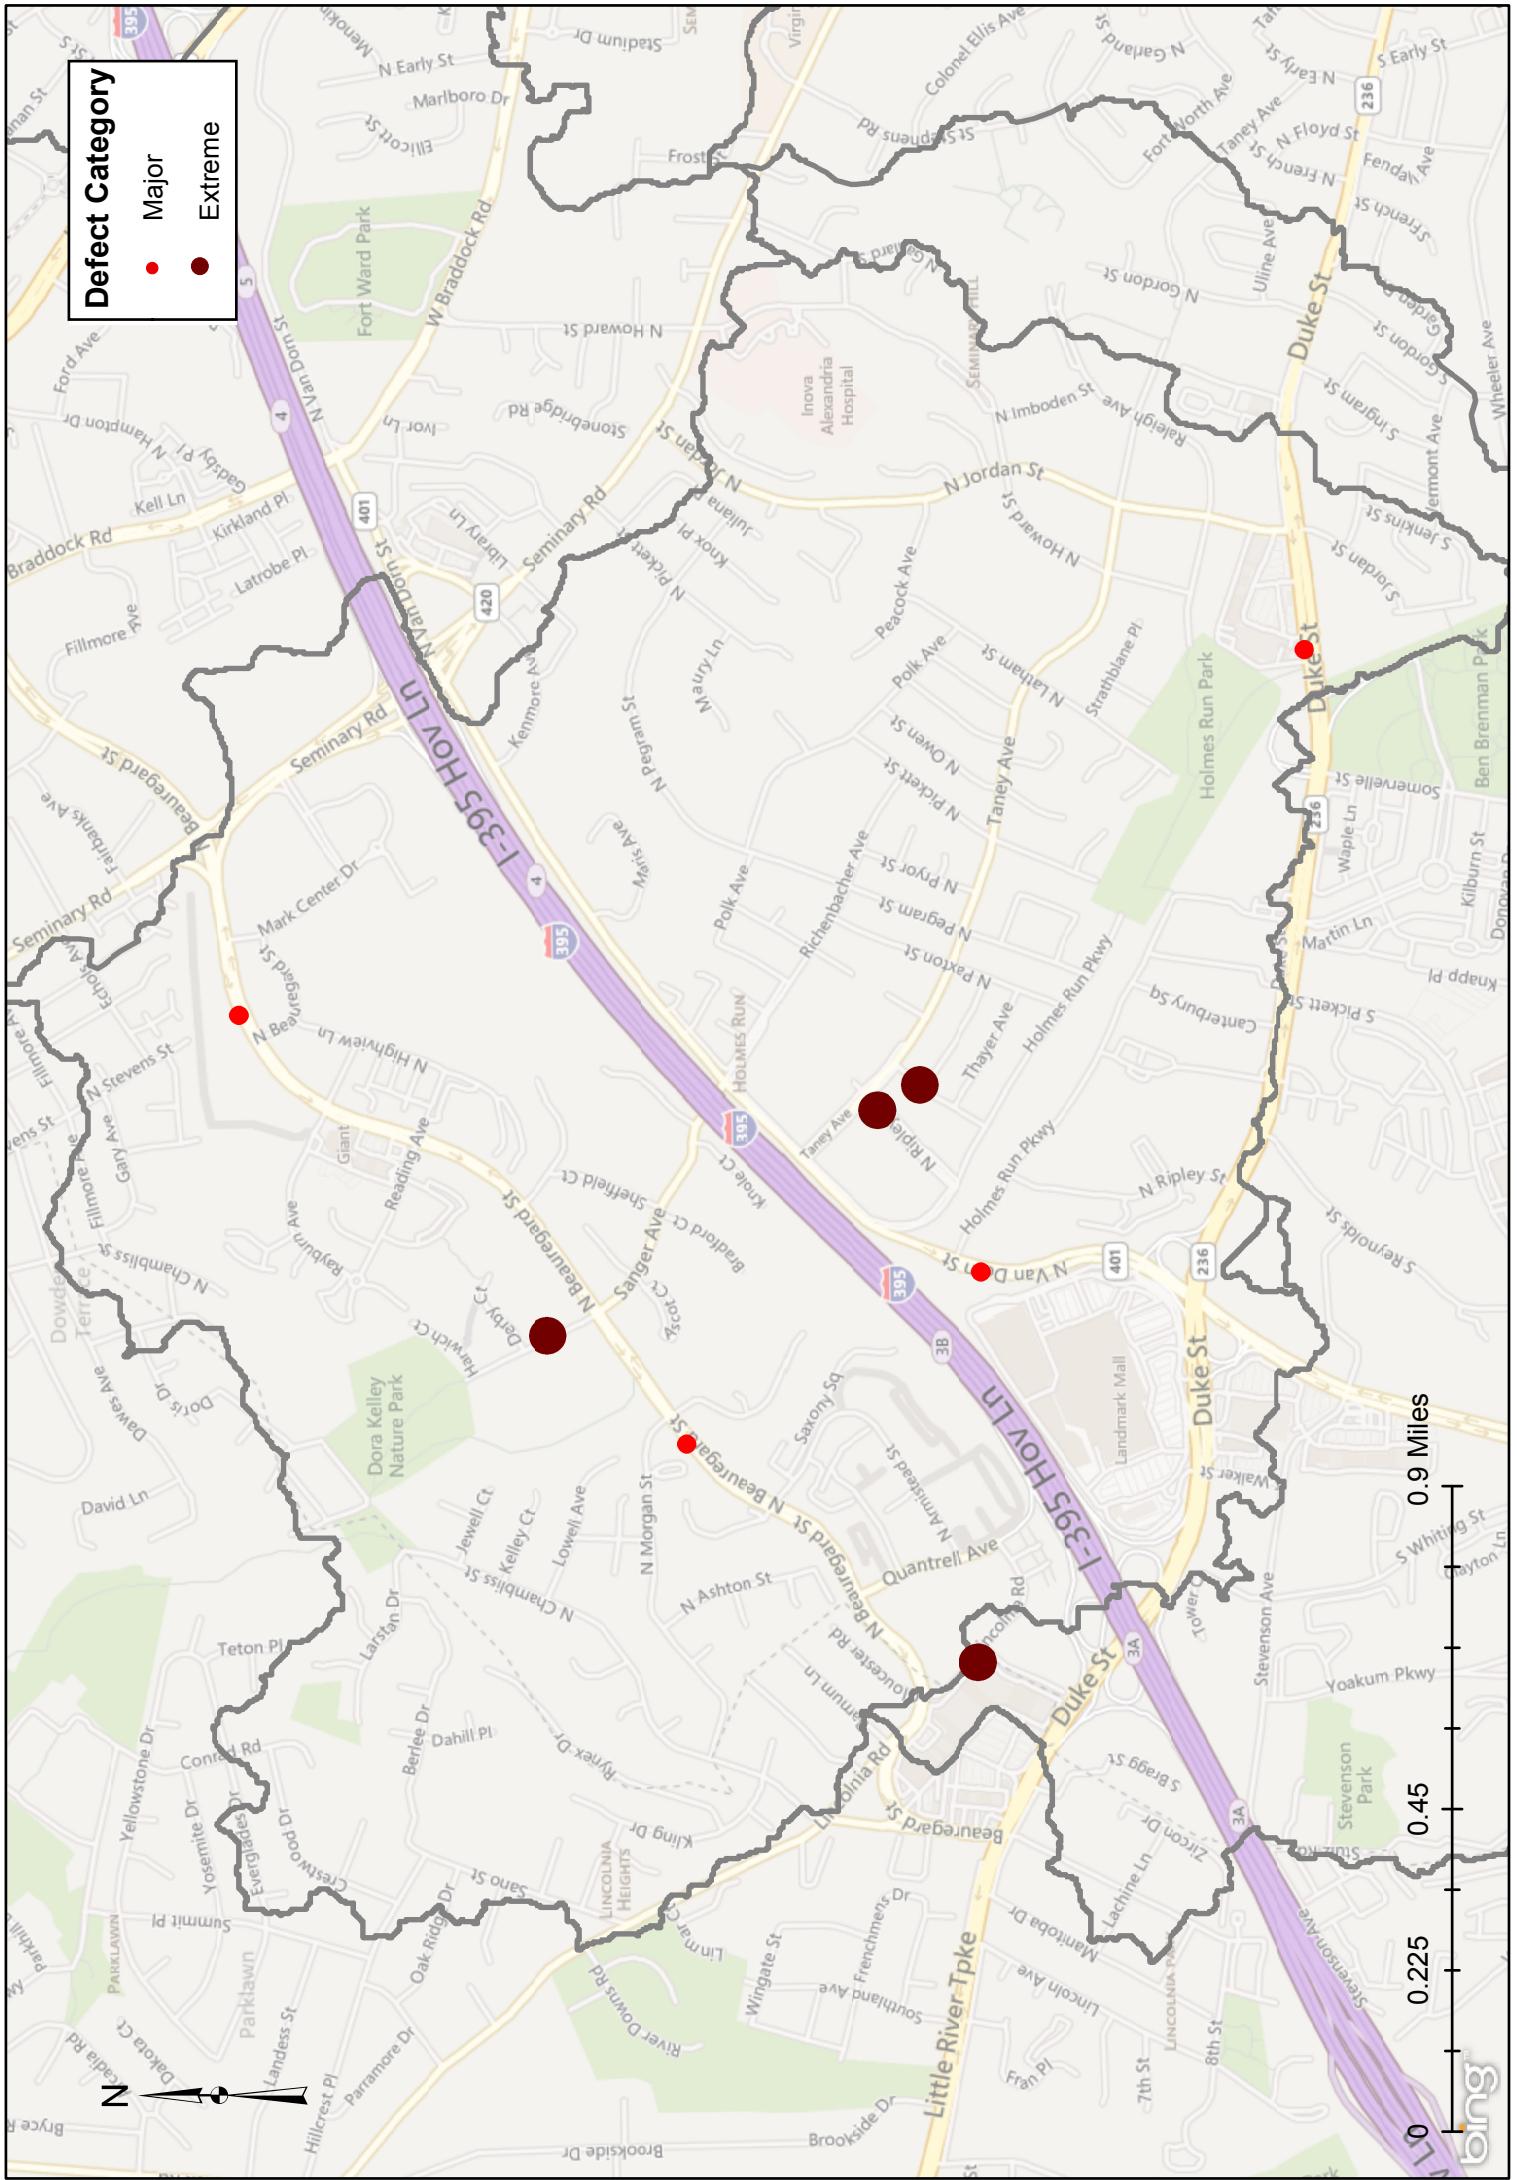

Observed defects were frequently associated with the chamber, chimney, and frame base seal components. Of the defects classified as major and extreme, most of them were still associated with the frame base seal, in addition to the manhole cover and channel. Cracks in the frame base seal 3/8" to 3/4" in size, for example, are considered major damage. Similarly, corrosion or spalling resulting in more than 50% material loss is considered extreme damage. Heavy debris (over 5 gallons in volume) in the channel is considered extreme. Figure 4 shows an example of major defects in the chamber.



**Figure 4. Settled Debris in Structure 009077IN
(Overall SCREAM Score = 50).**

Fourteen (14) of the structures inspected in Holmes Run watershed were identified in the major or extreme defect categories. The extreme defects were typically associated with the cover and frame base seal. Images of the fourteen (14) structures with overall SCREAM scores higher than 75 are shown in Figures 5 through 12. These issues can be remedied by adjustment of frame and cover or replacing the cover or inlet grate.



**Figure 5. Cracked Inlet Grate at Structure 004688IN
(Overall SCREAM Score = 99).**



**Figure 6. Cracked Cover at Structure 001067SMH
(Overall SCREAM Score = 99).**



**Figure 7. Cracked Cover at Structure 001072SMH
(Overall SCREAM Score = 99).**



**Figure 8. Cracked Inlet Grate at Structure 002941IN
(Overall SCREAM Score = 99).**



**Figure 9. Frame Base Seal Damage at Structure 000680SMH
(Overall SCREAM Score = 82).**



**Figure 10. Frame Base Seal Damage at Structure 000645SMH
(Overall SCREAM Score = 81).**



**Figure 11. Frame Base Seal Damage at Structure 000905SMH
(Overall SCREAM Score = 79).**



**Figure 12. Frame Base Seal Damage at Structure 003329IN
(Overall SCREAM Score = 76).**

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

There were 32 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

Pipeline Inspections

Figure 13 shows a summary of the inspection results by severity of the pipe defect. Figure 14 shows a map of the location of each inspected pipeline, color coded by defect severity. The average condition score of 964 storm pipe segments inspected within the Holmes Run watershed was 1.6 (Few to No defects). Inspection results in Holmes Run watershed showed that the pipe segments were observed to be in generally excellent condition, with no defect observed in 95% of the pipes.

Nineteen (19) pipe segments were classified as exhibiting few observed defects. Observed defects include small circumferential or longitudinal cracks (1/16" width), infiltration evidence (less than 1/4 gpm), and fine root intrusions. One (1) pipe segment was identified in the major defect category (score of 65) and three (3) pipes in the extreme defect category (scoring 90, 92, and 100). The major defects were typically multiple cracks, significant infiltration, open or offset joints, or broken pipes. Figures 15 through 18 are images taken from the inspections associated with the highest defect pipelines.

Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.

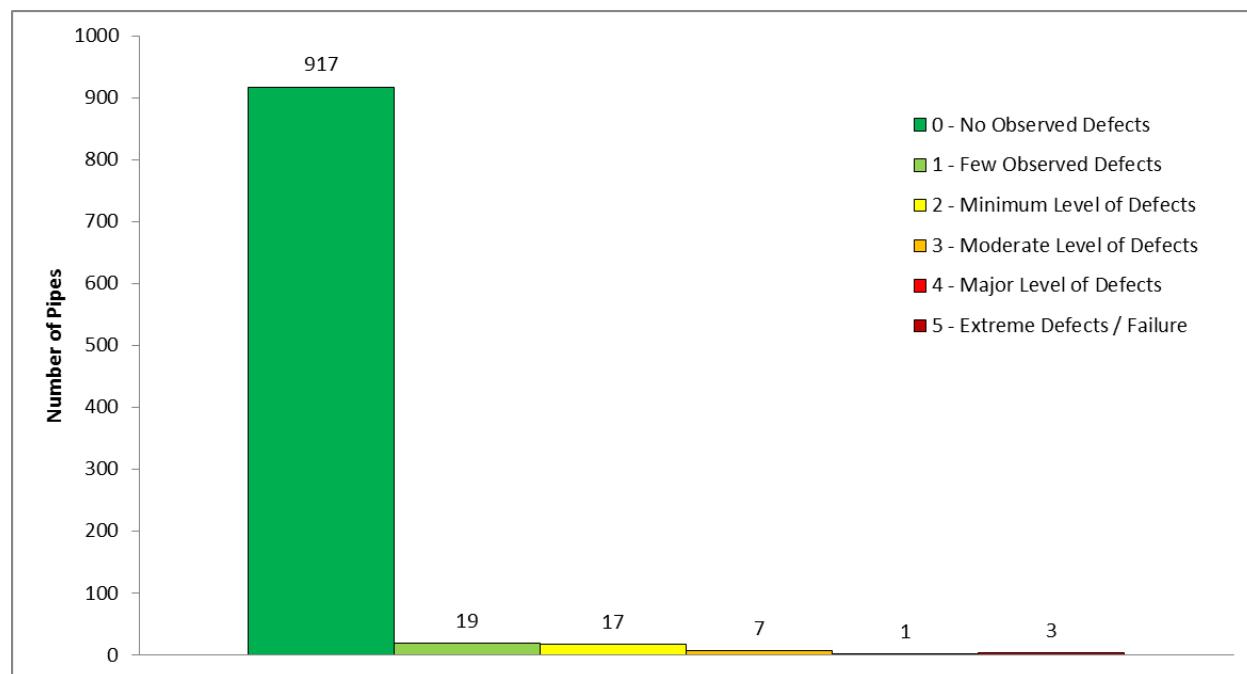
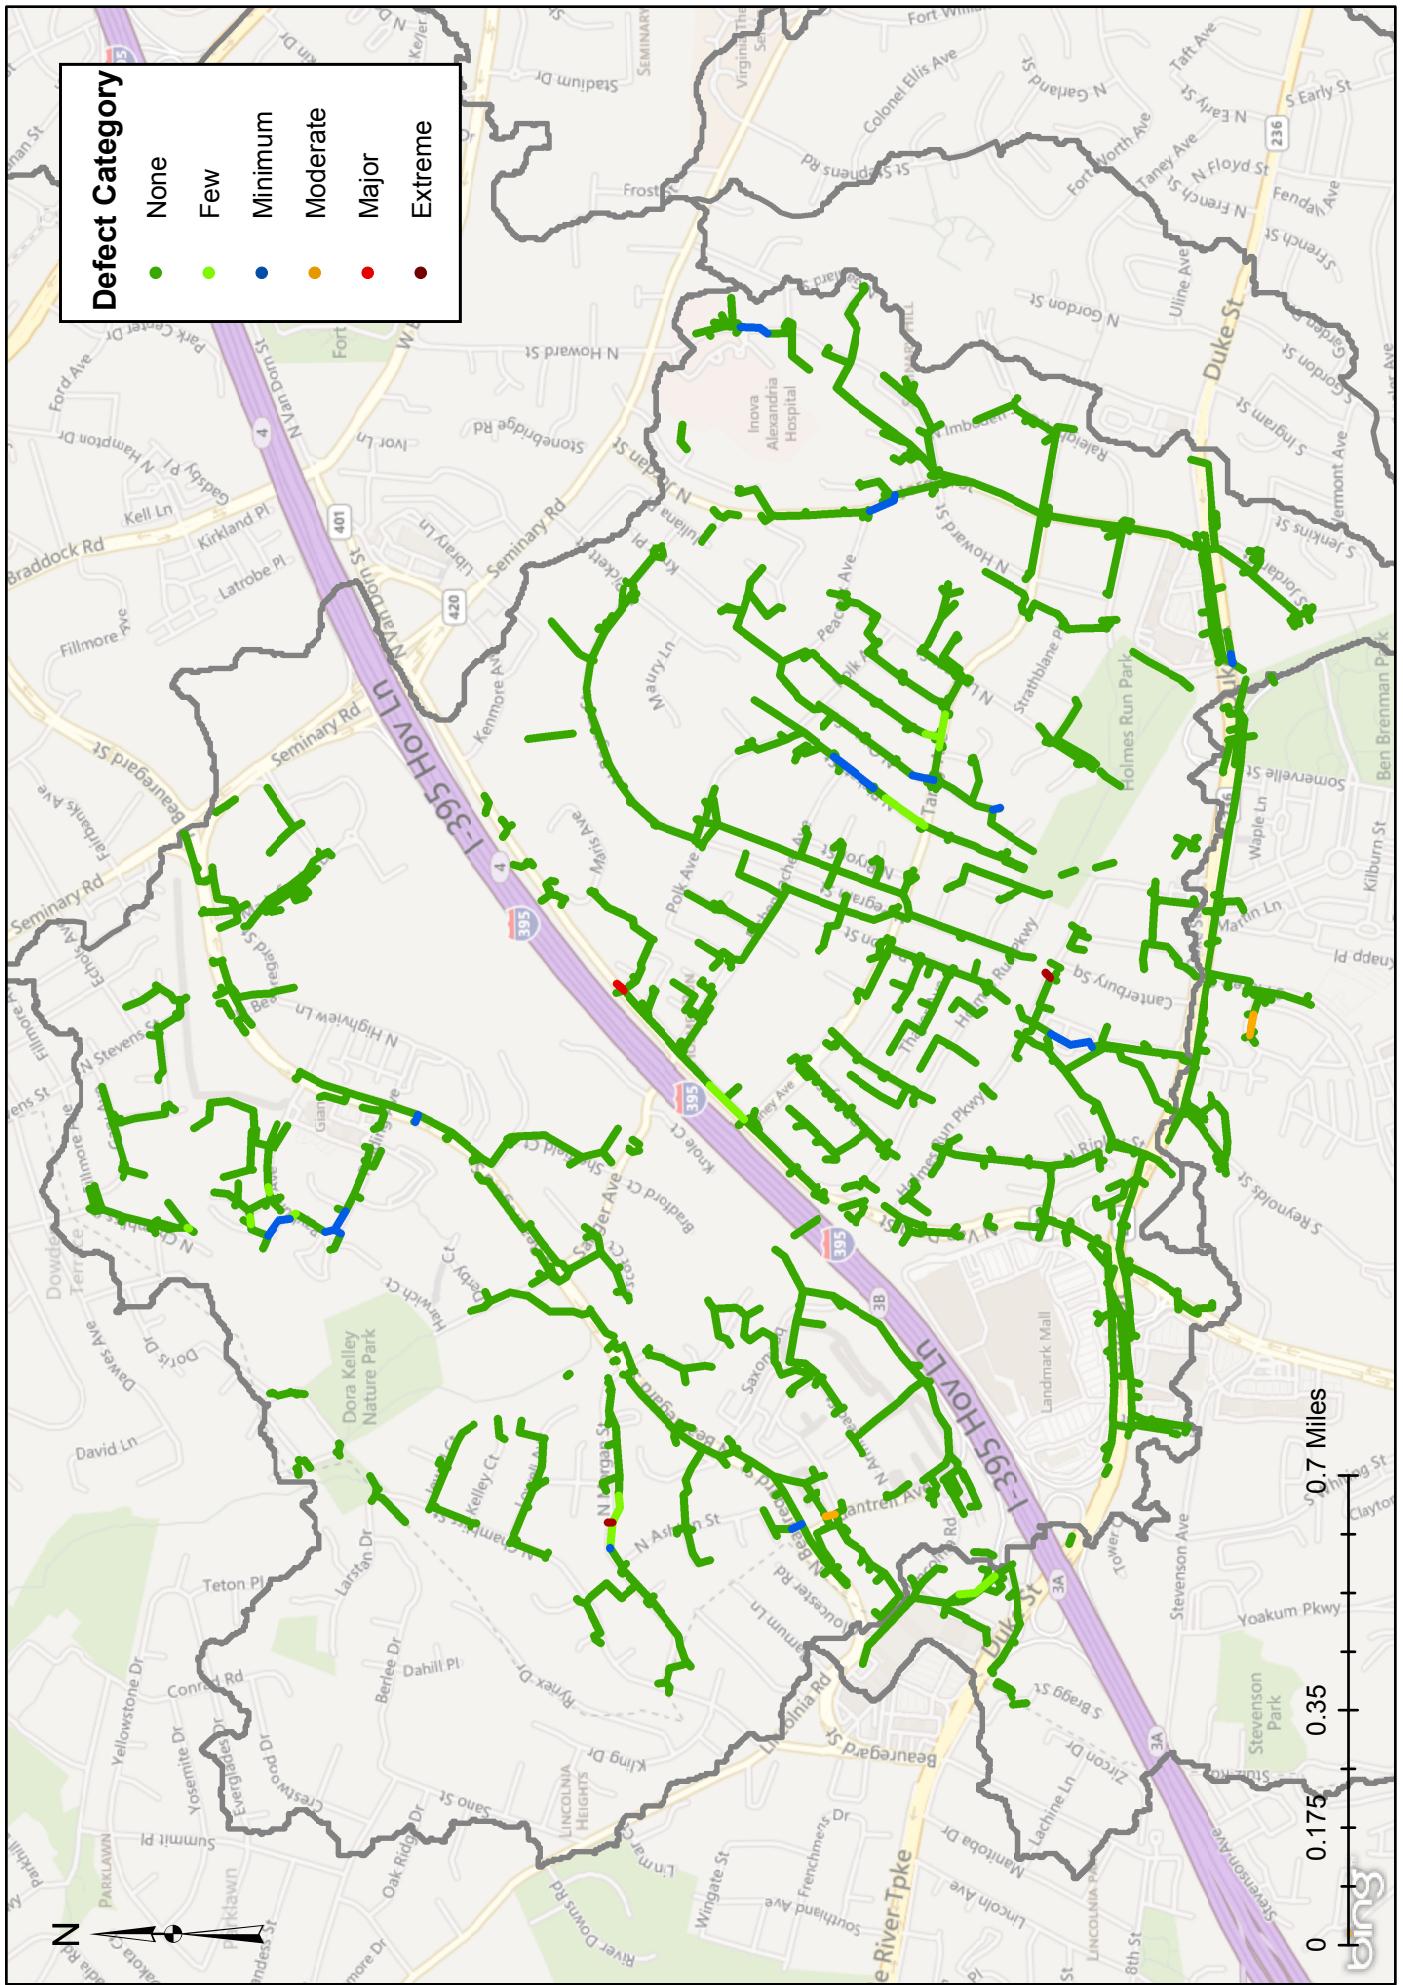


Figure 13. Pipe Lamping Inspection Summary.

Figure 14. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).





**Figure 15. Large Joint Offset in 24-in Storm Pipe between Structures 003857IN and 000274IO
(Overall SCREAM Score = 92).**



**Figure 16. Broken 15-in Storm Pipe between Structures 004778IN and 001527SMH
(Overall SCREAM Score = 53).**



**Figure 17. Debris in 15-in Storm Pipe between Structures 002982IN and 000999SMH
(Overall SCREAM Score = 90).**



**Figure 18. Debris in 15-in Storm Pipe between Structures 002802IN and 002803IN
(Overall SCREAM Score = 100).**

Summary

In total, 506 storm sewer structures and 964 associated pipelines were visually inspected for defects and damage using the lamping technique of condition assessment. Overall, the storm sewer infrastructure within the Holmes Run watershed is in good condition. The average condition score for storm structures was 45 (Moderate) and the average condition score for pipe segments was approximately 1.6 (Few). About one percent of the inspected structures, and fewer than 0.4 percent of the inspected storm pipe segments, had extreme observed defects.

Appendix A – Structure Inspection Summary

(Sorted by Defect Score)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

Alexandria - Holmes Run

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001067SMH | X | 5355 | TRUMAN AV | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 99 | 99 | 15 | 0 | 4 |
| Holmes Run | 001072SMH | X | 709 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 99 | 99 | 0 | 0 | 3 |
| Holmes Run | 002941IN | X | 1250 | N BEAUREGARD ST | Easement | 05/10/2012 | Truck 1 | Complete Inspection | 99 | 99 | 0 | 0 | 3 |
| Holmes Run | 004688IN | X | 6130 | LINCOLNIA RD | Driveway | 08/14/2012 | Truck 1 | Complete Inspection | 99 | 99 | 0 | 0 | 4 |
| Holmes Run | 000680SMH | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | Truck 1 | Complete Inspection | 82 | 82 | 0 | 0 | 3 |
| Holmes Run | 000645SMH | X | 1851 | N BEAUREGARD ST | Sidewalk | 07/11/2012 | Truck 1 | Complete Inspection | 81 | 81 | 0 | 0 | 3 |
| Holmes Run | 000905SMH | X | 6042 | MORGAN CT | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 79 | 80 | 0 | 0 | 2 |
| Holmes Run | 003329IN | X | 420 | N VAN DORN ST | Sidewalk | 05/09/2012 | Truck 1 | Complete Inspection | 76 | 76 | 0 | 0 | 3 |
| Holmes Run | 000999SMH | X | 5402 | BARRISTER PL | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 73 | 66 | 40 | 0 | 3 |
| Holmes Run | 003373IN | X | 789 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 73 | 66 | 50 | 0 | 4 |
| Holmes Run | 001238SMH | X | 5425 | N RIPLEY ST | Yard-Side | 06/20/2012 | Truck 1 | Complete Inspection | 72 | 73 | 0 | 0 | 2 |
| Holmes Run | 001323SMH | X | 5990 | DUKE ST | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 72 | 73 | 0 | 0 | 4 |
| Holmes Run | 000903SMH | X | 6212 | N MORGAN ST | Driveway | 04/27/2012 | Truck 1 | Complete Inspection | 71 | 71 | 0 | 0 | 2 |
| Holmes Run | 001000SMH | X | 5402 | BARRISTER PL | Parking Lot | 06/08/2012 | Truck 1 | Complete Inspection | 70 | 71 | 0 | 0 | 3 |
| Holmes Run | 001528SMH | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | Truck 1 | Complete Inspection | 70 | 71 | 0 | 0 | 4 |
| Holmes Run | 003875IN | X | 5125 | DUKE ST | Parking Lot | 06/11/2012 | Truck 1 | Complete Inspection | 70 | 61 | 35 | 0 | 4 |
| Holmes Run | 004056SMH | X | 5340 | HOLMES RUN PY | Parking Lot | 10/19/2012 | Truck 1 | Complete Inspection | 70 | 71 | 0 | 0 | 3 |
| Holmes Run | 000753SMH | X | 492 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 69 | 70 | 0 | 0 | 2 |
| Holmes Run | 001005SMH | X | 1148 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 69 | 69 | 5 | 0 | 3 |
| Holmes Run | 001050SMH | X | 708 | N PEGRAM ST | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 69 | 69 | 0 | 0 | 2 |
| Holmes Run | 001241SMH | X | 100 | RIPLEY ST N | Light Highway Rural Streets | 08/17/2012 | Truck 1 | Complete Inspection | 69 | 70 | 0 | 0 | 4 |
| Holmes Run | 001251SMH | X | 5125 | DUKE ST | Driveway | 06/11/2012 | Truck 1 | Complete Inspection | 69 | 66 | 35 | 0 | 4 |
| Holmes Run | 000909SMH | X | 5875 | LOWELL AV | Easement | 04/30/2012 | Truck 1 | Complete Inspection | 68 | 69 | 0 | 0 | 2 |
| Holmes Run | 000978SMH | X | 6108 | N MORGAN ST | Light Highway Rural Streets | 04/30/2012 | Truck 1 | Complete Inspection | 68 | 69 | 0 | 0 | 4 |
| Holmes Run | 000984SMH | X | 903 | N JORDAN ST | Parking Lot | 06/13/2012 | Truck 1 | Complete Inspection | 68 | 69 | 0 | 0 | 2 |
| Holmes Run | 001051SMH | X | 5308 | TANEY AV | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 68 | 69 | 0 | 0 | 4 |
| Holmes Run | 001065SMH | X | 607 | N PELHAM ST | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 68 | 60 | 35 | 0 | 4 |
| Holmes Run | 002693IN | X | 800 | N JORDAN ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 68 | 68 | 5 | 0 | 2 |
| Holmes Run | 002983IN | X | 5418 | N VAN DORN ST | Sidewalk | 06/08/2012 | Truck 1 | Complete Inspection | 68 | 69 | 0 | 0 | 2 |
| Holmes Run | 000920SMH | X | 1201 | SANGER AV | Light Highway Rural Streets | 05/10/2012 | Truck 1 | Complete Inspection | 67 | 68 | 0 | 0 | 2 |
| Holmes Run | 000962SMH | X | 800 | N JORDAN ST | Yard-Front | 06/13/2012 | Truck 1 | Complete Inspection | 67 | 66 | 20 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001073SMH | X | 633 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 67 | 68 | 0 | 0 | 4 |
| Holmes Run | 002803IN | X | 6030 | N BEAUREGARD ST | Sidewalk | 05/02/2012 | Truck 1 | Complete Inspection | 67 | 52 | 40 | 0 | 3 |
| Holmes Run | 000964SMH | X | 901 | JUNIPER PL | Light Highway Rural Streets | 06/13/2012 | Truck 1 | Complete Inspection | 66 | 67 | 0 | 0 | 3 |
| Holmes Run | 001071SMH | X | 5402 | TANEY AV | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 66 | 67 | 0 | 0 | 3 |
| Holmes Run | 000681SMH | X | 4600 | DUKE ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 4 |
| Holmes Run | 000948SMH | X | 607 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 65 | 57 | 48 | 0 | 3 |
| Holmes Run | 000951SMH | X | 5001 | TANEY AV | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 4 |
| Holmes Run | 000977SMH | X | 6140 | N MORGAN ST | Light Highway Rural Streets | 04/30/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 4 |
| Holmes Run | 000994SMH | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 65 | 65 | 0 | 0 | 5 |
| Holmes Run | 001055SMH | X | 610 | TRUMAN AV | Light Highway Rural Streets | 05/17/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 3 |
| Holmes Run | 003344IN | X | 5401 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 65 | 65 | 5 | 0 | 2 |
| Holmes Run | 003817IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 3 |
| Holmes Run | 003906IN | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 65 | 66 | 0 | 0 | 2 |
| Holmes Run | 000768SMH | X | 901 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 000843SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 2 |
| Holmes Run | 000914SMH | X | 5700 | SANGER AV | Yard-Side | 05/10/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 000916SMH | X | 1201 | SANGER AV | Light Highway Rural Streets | 05/10/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 000981SMH | X | 6015 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 2 |
| Holmes Run | 001006SMH | X | 1148 | POLK AV | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 001217SMH | X | 5319 | HOLMES RUN PY | Light Highway Rural Streets | 05/17/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 4 |
| Holmes Run | 001269SMH | X | 5200 | DUKE ST | Light Highway Rural Streets | 08/14/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 001457SMH | X | 1465 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 001459SMH | X | 1425 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 64 | 65 | 0 | 0 | 2 |
| Holmes Run | 000931SMH | X | 4806 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 63 | 64 | 0 | 0 | 5 |
| Holmes Run | 000982SMH | X | 6000 | MORGAN CT | Sidewalk | 05/02/2012 | Truck 1 | Complete Inspection | 63 | 64 | 0 | 0 | 2 |
| Holmes Run | 001010SMH | X | 1221 | SANGER AV | Light Highway Rural Streets | 04/25/2012 | Truck 1 | Complete Inspection | 63 | 64 | 0 | 0 | 4 |
| Holmes Run | 001527IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | Truck 1 | Complete Inspection | 63 | 64 | 0 | 0 | 2 |
| Holmes Run | 000748SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 3 |
| Holmes Run | 000754SMH | X | 495 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 2 |
| Holmes Run | 000902SMH | X | 5864 | LOWELL AV | Light Highway Rural Streets | 04/30/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 3 |
| Holmes Run | 000934SMH | X | 501 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 62 | 62 | 20 | 0 | 5 |
| Holmes Run | 001008SMH | X | 1321 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 62 | 64 | 0 | 0 | 3 |
| Holmes Run | 001505SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 002252IN | X | 4630 | RALEIGH AV | Sidewalk | 05/31/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 4 |
| Holmes Run | 003020IN | X | 5402 | N VAN DORN ST | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 3 |
| Holmes Run | 004059SMH | X | 903 | JUNIPER PL | Parking Lot | 10/19/2012 | Truck 1 | Complete Inspection | 62 | 63 | 0 | 0 | 5 |
| Holmes Run | 000910SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 000918SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 000937SMH | X | 504 | OWEN ST N | Light Highway Rural Streets | 10/19/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 000961SMH | X | 4500 | PEACOCK AV | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 4 |
| Holmes Run | 001011SMH | X | 1221 | SANGER AV | Light Highway Rural Streets | 04/25/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 001058SMH | X | 518 | N PAXTON ST | Light Highway Rural Streets | 05/17/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 3 |
| Holmes Run | 001223SMH | X | 301 | N PAXTON ST | Light Highway Rural Streets | 05/24/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 001230SMH | X | 200 | N RIPLEY ST | Easement | 05/22/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 001233SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 3 |
| Holmes Run | 001279SMH | X | 5412 | DUKE ST | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 61 | 61 | 15 | 0 | 4 |
| Holmes Run | 001527SMH | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 3 |
| Holmes Run | 002916IN | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 3 |
| Holmes Run | 003019IN | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 004054SMH | X | 1121 | SEMINARY RD | Easement | 06/14/2012 | Truck 1 | Complete Inspection | 61 | 60 | 5 | 0 | 3 |
| Holmes Run | 000933SMH | X | 497 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 60 | 61 | 0 | 0 | 4 |
| Holmes Run | 001074SMH | X | 701 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 60 | 61 | 0 | 0 | 4 |
| Holmes Run | 004066IN | X | 25 | S PICKETT ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 60 | 55 | 30 | 0 | 3 |
| Holmes Run | 000716SMH | X | 95 | DUKE ST | Parking Lot | 06/28/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 3 |
| Holmes Run | 000765SMH | X | 4636 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 4 |
| Holmes Run | 000997SMH | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 3 |
| Holmes Run | 001004SMH | X | 5418 | BARRISTER PL | Yard-Side | 06/08/2012 | Truck 1 | Complete Inspection | 59 | 61 | 0 | 0 | 2 |
| Holmes Run | 001054SMH | X | 5312 | N PAXTON ST | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 6 |
| Holmes Run | 001225SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 2 |
| Holmes Run | 002295IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 59 | 43 | 35 | 0 | 3 |
| Holmes Run | 003321IN | X | 5501 | HOLMES RUN PY | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 59 | 60 | 0 | 0 | 5 |
| Holmes Run | 000763SMH | X | 320 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 58 | 60 | 0 | 0 | 5 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000764SMH | X | 320 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 58 | 60 | 0 | 0 | 2 |
| Holmes Run | 000766SMH | X | 800 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 58 | 60 | 0 | 0 | 2 |
| Holmes Run | 000922SMH | X | 4703 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 58 | 59 | 0 | 0 | 5 |
| Holmes Run | 001061SMH | X | 5328 | TANEY AV | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 58 | 59 | 0 | 0 | 3 |
| Holmes Run | 001216SMH | X | 5319 | HOLMES RUN PY | Light Highway Rural Streets | 05/17/2012 | Truck 1 | Complete Inspection | 58 | 59 | 0 | 0 | 2 |
| Holmes Run | 001281SMH | X | 30 | S REYNOLD ST | Driveway | 06/20/2012 | Truck 1 | Complete Inspection | 58 | 59 | 0 | 0 | 3 |
| Holmes Run | 002932IN | X | 1250 | SANGER AV | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 58 | 50 | 35 | 0 | 1 |
| Holmes Run | 000759SMH | X | 4630 | RALEIGH AV | Light Highway Rural Streets | 05/31/2012 | Truck 1 | Complete Inspection | 57 | 58 | 0 | 0 | 3 |
| Holmes Run | 000774SMH | X | 4520 | DUKE ST | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 57 | 58 | 0 | 0 | 4 |
| Holmes Run | 000988SMH | X | 901 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | Truck 1 | Complete Inspection | 57 | 58 | 0 | 0 | 2 |
| Holmes Run | 001228SMH | X | 200 | N RIPLEY ST | Driveway | 05/22/2012 | Truck 1 | Complete Inspection | 57 | 58 | 0 | 0 | 2 |
| Holmes Run | 001248SMH | X | 488 | N OWEN ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 57 | 59 | 0 | 0 | 3 |
| Holmes Run | 001272SMH | X | 5701 | DUKE ST | Light Highway Rural Streets | 07/24/2012 | Truck 1 | Complete Inspection | 57 | 57 | 15 | 0 | 4 |
| Holmes Run | 002239IN | X | 4634 | TANEY AV | Sidewalk | 05/31/2012 | Truck 1 | Complete Inspection | 57 | 58 | 0 | 0 | 3 |
| Holmes Run | 000503SMH | X | 1519 | CHAMBLISS ST N | Light Highway Rural Streets | 08/14/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000527SMH | X | 5628 | GARY AV | Light Highway Rural Streets | 07/31/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000647SMH | X | 1851 | N BEAUREGARD ST | Light Highway Rural Streets | 07/11/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000654SMH | X | 5703 | N BEAUREGARD ST | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000672SMH | X | 1461 | N BEAUREGARD ST | Easement | 07/11/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000682SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000683SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000715SMH | X | 4520 | DUKE ST | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000775SMH | X | 4520 | DUKE ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000776SMH | X | 4520 | DUKE ST | Light Highway Rural Streets | 07/26/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000904SMH | X | 6066 | MORGAN CT | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000906SMH | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000917SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000923SMH | X | 4801 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000928SMH | X | 505 | NAYLOR ST N | Light Highway Rural Streets | 10/19/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000946SMH | X | 701 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000947SMH | X | 609 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000958SMH | X | 919 | KEMPER ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 000985SMH | X | 903 | N JORDAN ST | Parking Lot | 06/13/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 000989SMH | X | 901 | JUNIPER PL | Light Highway Rural Streets | 10/19/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 5 |
| Holmes Run | 000995SMH | X | 5445 | RICHENBACHER AV | Sidewalk | 06/08/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000996SMH | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001009SMH | X | 1340 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001052SMH | X | 5308 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001057SMH | X | 5312 | N PAXTON ST | Light Highway Rural Streets | 05/17/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 6 |
| Holmes Run | 001063SMH | X | 5367 | HOLMES RUN PY | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001069SMH | X | 5350 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001097SMH | X | 631 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001229SMH | X | 200 | N RIPLEY ST | Driveway | 05/22/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001232SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001239SMH | X | 5425 | N RIPLEY ST | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001245SMH | X | 200 | N RIPLEY ST | Easement | 07/24/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 6 |
| Holmes Run | 001259SMH | X | 5340 | HOLMES RUN PY | Parking Lot | 05/24/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001268SMH | X | 5150 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001271SMH | X | 5200 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001273SMH | X | 100 | DUKE ST | Light Highway Rural Streets | 07/24/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001274SMH | X | 5350 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001275SMH | X | 5311 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001276SMH | X | 5220 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001277SMH | X | 5220 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001324SMH | X | 5990 | DUKE ST | Sidewalk | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001325SMH | X | 5990 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001328SMH | X | 5801 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001340SMH | X | 5801 | DUKE ST | Light Highway Rural Streets | 07/24/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001341SMH | X | 5801 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001344SMH | X | 5990 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001458SMH | X | 1445 | SEMINARY RD | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001460SMH | X | 1425 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001461SMH | X | 1415 | SEMINARY RD | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001476SMH | X | 5425 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001479SMH | X | 1400 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001480SMH | X | 1380 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001499SMH | X | 301 | BEAUREGARD ST N | Driveway | 08/14/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001503SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 1 |
| Holmes Run | 001504SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001520SMH | X | 729 | QUANTRELL AV | Yard-Front | 05/07/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 002237IN | X | 4634 | TANEY AV | Sidewalk | 05/31/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 003937IN | X | 5205 | DUKE ST | Sidewalk | 06/11/2012 | Truck 1 | Complete Inspection | 56 | 38 | 35 | 0 | 2 |
| Holmes Run | 004053SMH | X | 1461 | N BEAUREGARD ST | Easement | 07/11/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 004063SMH | X | 2000 | BEAUREGARD ST N | Light Highway Rural Streets | 08/17/2012 | Truck 1 | Complete Inspection | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 002824IN | X | 6116 | N MORGAN ST | Sidewalk | 04/30/2012 | Truck 1 | Complete Inspection | 55 | 56 | 0 | 0 | 3 |
| Holmes Run | 003367IN | X | 901 | A TANEY AV | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 55 | 53 | 2 | 0 | 3 |
| Holmes Run | 004678IN | X | 5925 | QUANTRELL AV | Sidewalk | 05/07/2012 | Truck 1 | Complete Inspection | 55 | 56 | 0 | 0 | 3 |
| Holmes Run | 000507SMH | X | 6000 | JEWELL CT | Light Highway Rural Streets | 04/24/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 5 |
| Holmes Run | 000508SMH | X | 5916 | JEWELL CT | Light Highway Rural Streets | 04/24/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 000659SMH | X | 2301 | N SIBLEY ST | Light Highway Rural Streets | 04/23/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 000743SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 06/29/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 4 |
| Holmes Run | 000752SMH | X | 491 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 4 |
| Holmes Run | 000773SMH | X | 4520 | DUKE ST | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 54 | 54 | 0 | 0 | 2 |
| Holmes Run | 000950SMH | X | 509 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 000957SMH | X | 907 | KEMPER ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 000970SMH | X | 1125 | ANDERSON ST | Light Highway Rural Streets | 04/30/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000976SMH | X | 6212 | N MORGAN ST | Sidewalk | 04/27/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001043SMH | X | 495 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 4 |
| Holmes Run | 001044SMH | X | 487 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 001045SMH | X | 5101 | TANEY AV | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001218SMH | X | 501 | N PEGRAM ST | Easement | 05/17/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 001222SMH | X | 332 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001267SMH | X | 5150 | DUKE ST | Light Highway Rural Streets | 07/31/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001278SMH | X | 5350 | DUKE ST | Light Highway Rural Streets | 06/20/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 5 |
| Holmes Run | 001502SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001521SMH | X | 1131 | N BEAUREGARD ST | Light Highway Rural Streets | 05/03/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 001921IN | X | 1851 | N BEAUREGARD ST | Easement | 07/11/2012 | Truck 1 | Complete Inspection | 54 | 56 | 0 | 0 | 2 |
| Holmes Run | 002031IN | X | 1851 | N BEAUREGARD ST | Easement | 07/11/2012 | Truck 1 | Complete Inspection | 54 | 56 | 0 | 0 | 2 |
| Holmes Run | 002718IN | X | 903 | N JORDAN ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 54 | 54 | 0 | 0 | 2 |
| Holmes Run | 002719IN | X | 903 | N JORDAN ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 54 | 54 | 0 | 0 | 1 |
| Holmes Run | 002801IN | X | 6040 | N MORGAN ST | Sidewalk | 04/30/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 002930IN | X | 1250 | SANGER AV | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 54 | 54 | 0 | 0 | 2 |
| Holmes Run | 003011IN | X | 1250 | N BEAUREGARD ST | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 54 | 54 | 0 | 0 | 3 |
| Holmes Run | 003942IN | X | 5205 | DUKE ST | Alley | 06/11/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 004079IN | X | 50 | S PICKET ST | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 54 | 55 | 0 | 0 | 3 |
| Holmes Run | 000509SMH | X | 2323 | N CHAMBLISS ST | Easement | 04/16/2012 | Truck 1 | Complete Inspection | 53 | 54 | 0 | 0 | 2 |
| Holmes Run | 000662SMH | X | 5614 | N BEAUREGARD ST | Parking Lot | 04/16/2012 | Truck 1 | Complete Inspection | 53 | 55 | 0 | 0 | 3 |
| Holmes Run | 000924SMH | X | 503 | N MANSFIELD ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 53 | 55 | 0 | 0 | 2 |
| Holmes Run | 001075SMH | X | 602 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 53 | 53 | 0 | 0 | 3 |
| Holmes Run | 002954IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | Truck 1 | Complete Inspection | 53 | 54 | 0 | 0 | 2 |
| Holmes Run | 003171IN | X | 5102 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 53 | 54 | 0 | 0 | 3 |
| Holmes Run | 003292IN | X | 701 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 53 | 53 | 0 | 0 | 4 |
| Holmes Run | 003303IN | X | 602 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | Truck 1 | Complete Inspection | 53 | 53 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 003368IN | X | 5331 | A TANEY AV | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 53 | 53 | 0 | 0 | 2 |
| Holmes Run | 003822IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | Truck 1 | Complete Inspection | 53 | 54 | 0 | 0 | 2 |
| Holmes Run | 000528SMH | X | 5631 | GARY AV | Light Highway Rural Streets | 07/31/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 3 |
| Holmes Run | 000929SMH | X | 503 | NAYLOR ST N | Light Highway Rural Streets | 10/19/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 2 |
| Holmes Run | 000969SMH | X | 5940 | LOWELL AV | Light Highway Rural Streets | 04/30/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 4 |
| Holmes Run | 000983SMH | X | 1130 | N BEAUREGARD ST | Parking Lot | 05/03/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 4 |
| Holmes Run | 001064SMH | X | 511 | N PELHAM ST | Light Highway Rural Streets | 05/16/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 3 |
| Holmes Run | 001255SMH | X | 301 | PAXTON ST N | Parking Lot | 08/17/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 3 |
| Holmes Run | 001920IN | X | 1851 | N BEAUREGARD ST | Sidewalk | 07/11/2012 | Truck 1 | Complete Inspection | 52 | 53 | 0 | 0 | 2 |
| Holmes Run | 003821IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | Truck 1 | Complete Inspection | 52 | 50 | 2 | 0 | 2 |
| Holmes Run | 000915SMH | X | 5700 | SANGER AV | Yard-Side | 05/10/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 000945SMH | X | 703 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 001221SMH | X | 483 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 001226SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 1 |
| Holmes Run | 001236SMH | X | 5425 | N RIPLEY ST | Yard-Side | 06/20/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 001237SMH | X | 5425 | N RIPLEY ST | Sidewalk | 06/20/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 001249SMH | X | 5425 | DUKE ST | Parking Lot | 06/11/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 001326SMH | X | 5990 | S VAN DORN ST | Light Highway Rural Streets | 07/23/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 002817IN | X | 6030 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 002942IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 002953IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 4 |
| Holmes Run | 003017IN | X | 5445 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 003846IN | X | 486 | N OWEN ST | Yard-Back | 05/29/2012 | Truck 1 | Complete Inspection | 51 | 52 | 0 | 0 | 2 |
| Holmes Run | 000642SMH | X | 2000 | SEMINARY RD | Light Highway Rural Streets | 07/02/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 000661SMH | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/23/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 000669SMH | X | 5703 | N BEAUREGARD ST | Easement | 04/24/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 000747SMH | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 000878SMH | X | 1121 | SEMINARY RD | Easement | 06/14/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 4 |
| Holmes Run | 000912SMH | X | 1250 | N BEAUREGARD ST | Light Highway Rural Streets | 07/06/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 001090SMH | X | 301 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 50 | 50 | 0 | 0 | 3 |
| Holmes Run | 001234SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 001244SMH | X | 5425 | N RIPLEY ST | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001507SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 4 |
| Holmes Run | 001515SMH | X | 5851 | QUANTRELL AV | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 001952IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 002786IN | X | 6108 | N MORGAN ST | Sidewalk | 04/30/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 002828IN | X | 1118 | N HOWARD ST | Sidewalk | 06/14/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 002906IN | X | 6056 | MORGAN CT | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 50 | 50 | 0 | 0 | 4 |
| Holmes Run | 002923IN | X | 6054 | N MORGAN ST | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 003202IN | X | 5201 | TANEY AV | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 50 | 50 | 0 | 0 | 3 |
| Holmes Run | 004689IN | X | 301 | BEAUREGARD ST N | Driveway | 08/14/2012 | Truck 1 | Complete Inspection | 50 | 51 | 0 | 0 | 2 |
| Holmes Run | 004710IN | X | 5851 | QUANTRELL AV | Parking Lot | 05/04/2012 | Truck 1 | Complete Inspection | 50 | 50 | 0 | 0 | 2 |
| Holmes Run | 009077IN | X | 5008 | GARDNER DR | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 50 | 0 | 50 | 0 | 2 |
| Holmes Run | 000655SMH | X | 5601 | HARDING AV | Light Highway Rural Streets | 04/24/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 4 |
| Holmes Run | 000670SMH | X | 5900 | SANGER AV | Light Highway Rural Streets | 05/08/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 3 |
| Holmes Run | 000949SMH | X | 513 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 4 |
| Holmes Run | 000979SMH | X | 6020 | NAGY PL | Light Highway Rural Streets | 10/18/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 2 |
| Holmes Run | 001085SMH | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 3 |
| Holmes Run | 001088SMH | X | 5500 | HOLMES RUN PY | Easement | 05/22/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 3 |
| Holmes Run | 001525SMH | X | 5800 | QUANTRELL AV | Yard-Side | 05/07/2012 | Truck 1 | Complete Inspection | 49 | 50 | 0 | 0 | 3 |
| Holmes Run | 004679IN | X | 705 | QUANTRELL AV | Sidewalk | 05/07/2012 | Truck 1 | Complete Inspection | 49 | 45 | 10 | 0 | 3 |
| Holmes Run | 000749SMH | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 2 |
| Holmes Run | 000921SMH | X | 1221 | SANGER AV | Yard-Front | 04/25/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 4 |
| Holmes Run | 001007SMH | X | 5079 | POLK AV | Light Highway Rural Streets | 06/01/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 2 |
| Holmes Run | 002008IN | X | 1459 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | Truck 1 | Complete Inspection | 48 | 44 | 10 | 0 | 3 |
| Holmes Run | 002225IN | X | 4601 | STRATHBLANE PL | Sidewalk | 05/31/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 3 |
| Holmes Run | 002939IN | X | 1250 | N BEAUREGARD ST | Sidewalk | 05/10/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 3 |
| Holmes Run | 003927IN | X | 200 | N RIPLEY ST | Easement | 07/24/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 1 |
| Holmes Run | 003961IN | X | 5412 | DUKE ST | Sidewalk | 06/20/2012 | Truck 1 | Complete Inspection | 48 | 45 | 5 | 0 | 2 |
| Holmes Run | 004708IN | X | 6000 | QUANTRELL AV | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 48 | 49 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001046SMH | X | 741 | N PEGRAM ST | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 2 |
| Holmes Run | 001084SMH | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 3 |
| Holmes Run | 001096SMH | X | 851 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 3 |
| Holmes Run | 001282SMH | X | 34 | A S REYNOLD ST | Yard-Back | 06/20/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 3 |
| Holmes Run | 001519SMH | X | 5400 | N ARMISTEAD ST | Yard-Back | 07/17/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 3 |
| Holmes Run | 002195IN | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 2 |
| Holmes Run | 002562IN | X | 1121 | N HOWARD ST | Sidewalk | 06/14/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 2 |
| Holmes Run | 002819IN | X | 6000 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 47 | 48 | 0 | 0 | 3 |
| Holmes Run | 001220SMH | X | 484 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 46 | 47 | 0 | 0 | 2 |
| Holmes Run | 001231SMH | X | 200 | N RIPLEY ST | Easement | 05/22/2012 | Truck 1 | Complete Inspection | 46 | 46 | 0 | 0 | 2 |
| Holmes Run | 001453SMH | X | 4550 | N PICKETT ST | Yard-Side | 04/16/2012 | Truck 1 | Complete Inspection | 46 | 47 | 0 | 0 | 2 |
| Holmes Run | 001454SMH | X | 1330 | N PICKETT ST | Light Highway Rural Streets | 04/16/2012 | Truck 1 | Complete Inspection | 46 | 46 | 0 | 0 | 3 |
| Holmes Run | 002829IN | X | 1110 | N HOWARD ST | Sidewalk | 06/14/2012 | Truck 1 | Complete Inspection | 46 | 46 | 0 | 0 | 3 |
| Holmes Run | 000573SMH | X | 2456 | N BEAUREGARD ST | Sidewalk | 07/31/2012 | Truck 1 | Complete Inspection | 45 | 46 | 0 | 0 | 3 |
| Holmes Run | 000757SMH | X | 4636 | TANEY AV | Yard-Front | 05/31/2012 | Truck 1 | Complete Inspection | 45 | 42 | 5 | 0 | 2 |
| Holmes Run | 001525IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | Truck 1 | Complete Inspection | 45 | 46 | 0 | 0 | 3 |
| Holmes Run | 002226IN | X | 4612 | STRATHBLANE PL | Sidewalk | 05/31/2012 | Truck 1 | Complete Inspection | 45 | 46 | 0 | 0 | 2 |
| Holmes Run | 003022IN | X | 5401 | BARRISTER PL | Sidewalk | 06/08/2012 | Truck 1 | Complete Inspection | 45 | 38 | 10 | 0 | 3 |
| Holmes Run | 003857IN | X | 5300 | HOLMES RUN PY | Sidewalk | 05/23/2012 | Truck 1 | Complete Inspection | 45 | 46 | 0 | 0 | 3 |
| Holmes Run | 001080SMH | X | 420 | N VAN DORN ST | Sidewalk | 05/09/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 001984IN | X | 5614 | N BEAUREGARD ST | Sidewalk | 04/16/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002173IN | X | 5000 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002272IN | X | 320 | N JORDAN ST | Sidewalk | 07/05/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002678IN | X | 919 | KEMPER ST | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 002723IN | X | 903 | N JORDAN ST | Yard-Front | 06/13/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 4 |
| Holmes Run | 002732IN | X | 903 | N HOWARD ST | Sidewalk | 06/14/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 002779IN | X | 6140 | N MORGAN ST | Sidewalk | 04/30/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002795IN | X | 830 | N ASHTON ST | Sidewalk | 04/27/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002820IN | X | 835 | N BEAUREGARD ST | Easement | 05/03/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002917IN | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002956IN | X | 5900 | SANGER AV | Sidewalk | 05/08/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 002963IN | X | 5501 | SANGER AV | Yard-Front | 05/08/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 002967IN | X | 5429 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 002999IN | X | 5079 | POLK AV | Sidewalk | 06/01/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 003004IN | X | 1250 | SANGER AV | Sidewalk | 04/25/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 003023IN | X | 5408 | BARRISTER PL | Sidewalk | 06/08/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003133IN | X | 1148 | POLK AV | Easement | 06/01/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 5 |
| Holmes Run | 003134IN | X | 5079 | POLK AV | Sidewalk | 06/01/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 4 |
| Holmes Run | 003149IN | X | 1101 | PALMER PL | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003169IN | X | 5200 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003172IN | X | 5105 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 003237IN | X | 5308 | TANEY AV | Sidewalk | 05/14/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 003364IN | X | 901 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003820IN | X | 175 | DUKE ST | Sidewalk | 05/24/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003829IN | X | 5340 | HOLMES RUN PY | Sidewalk | 05/23/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 003854IN | X | 101 | DUKE ST | Parking Lot | 06/11/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003856IN | X | 101 | DUKE ST | Parking Lot | 06/11/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 003901IN | X | 501 | N PEGRAM ST | Sidewalk | 05/17/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003953IN | X | 5311 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003954IN | X | 5220 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 003960IN | X | 30 | S REYNOLD ST | Sidewalk | 06/20/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004251IN | X | 5801 | DUKE ST | Sidewalk | 07/23/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 4 |
| Holmes Run | 004672IN | X | 5400 | N MORGAN ST | Parking Lot | 07/17/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004675IN | X | 520 | N ARMISTEAD ST | Sidewalk | 05/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 4 |
| Holmes Run | 004676IN | X | 520 | N ARMISTEAD ST | Sidewalk | 05/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 004690IN | X | 6130 | N BRECKINRIDGE PL | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004705IN | X | 6000 | LINCOLNIA RD | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004718IN | X | 5750 | QUANTRELL AV | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 004753IN | X | 5400 | N ARMISTEAD ST | Parking Lot | 07/17/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 004754IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004755IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004775IN | X | 301 | N BEAUREGARD ST | Sidewalk | 05/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 004781IN | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 3 |
| Holmes Run | 004784IN | X | 5925 | QUANTRELL AV | Yard-Side | 05/07/2012 | Truck 1 | Complete Inspection | 44 | 45 | 0 | 0 | 2 |
| Holmes Run | 000656SMH | X | 5601 | HARDING AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 43 | 44 | 0 | 0 | 2 |
| Holmes Run | 000663SMH | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/16/2012 | Truck 1 | Complete Inspection | 43 | 44 | 0 | 0 | 2 |
| Holmes Run | 001089SMH | X | 5500 | HOLMES RUN PY | Easement | 05/22/2012 | Truck 1 | Complete Inspection | 43 | 44 | 0 | 0 | 2 |
| Holmes Run | 001950IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 43 | 44 | 0 | 0 | 3 |
| Holmes Run | 002729IN | X | 903 | N HOWARD ST | Sidewalk | 06/14/2012 | Truck 1 | Complete Inspection | 43 | 38 | 15 | 0 | 3 |
| Holmes Run | 003853IN | X | 101 | RIPLEY ST N | Parking Lot | 10/19/2012 | Truck 1 | Complete Inspection | 43 | 38 | 15 | 0 | 1 |
| Holmes Run | 000339ND | X | 6020 | NAGY PL | Yard-Back | 10/18/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 2 |
| Holmes Run | 000744SMH | X | 4725 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 4 |
| Holmes Run | 000930SMH | X | 500 | N NAYLOR ST | Light Highway Rural Streets | 05/30/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001961IN | X | 5697 | RAYBURN AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 2 |
| Holmes Run | 001985IN | X | 5612 | HARDING AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 2 |
| Holmes Run | 002030IN | X | 2000 | SEMINARY RD | Curb/Gutter | 07/03/2012 | Truck 1 | Complete Inspection | 42 | 38 | 5 | 0 | 2 |
| Holmes Run | 002296IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 2 |
| Holmes Run | 002794IN | X | 835 | N ASHTON ST | Sidewalk | 04/27/2012 | Truck 1 | Complete Inspection | 42 | 38 | 5 | 0 | 4 |
| Holmes Run | 002797IN | X | 6008 | NAGY PL | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 42 | 38 | 5 | 0 | 2 |
| Holmes Run | 002799IN | X | 830 | ASHTON ST N | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 1 |
| Holmes Run | 002822IN | X | 5909 | LOWELL AV | Sidewalk | 04/30/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 2 |
| Holmes Run | 002945IN | X | 1250 | SANGER AV | Sidewalk | 07/06/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 2 |
| Holmes Run | 002951IN | X | 1221 | SANGER AV | Yard-Front | 04/25/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 3 |
| Holmes Run | 002962IN | X | 5501 | SANGER AV | Parking Lot | 05/08/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 3 |
| Holmes Run | 003285IN | X | 5401 | TANEY AV | Sidewalk | 05/16/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 4 |
| Holmes Run | 003936IN | X | 5125 | DUKE ST | Sidewalk | 06/11/2012 | Truck 1 | Complete Inspection | 42 | 43 | 0 | 0 | 2 |
| Holmes Run | 009060IN | X | 5340 | HOLMES RUN PY | Parking Lot | 10/19/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 3 |
| Holmes Run | 009062IN | X | 5340 | HOLMES RUN PY | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 42 | 42 | 0 | 0 | 3 |
| Holmes Run | 003899IN | X | 5100 | SUTTON PL | Yard-Back | 05/17/2012 | Truck 1 | Complete Inspection | 40 | 40 | 0 | 0 | 3 |
| Holmes Run | 009064IN | X | 486 | OWEN ST N | Yard-Back | 10/19/2012 | Truck 1 | Complete Inspection | 40 | 40 | 0 | 0 | 2 |
| Holmes Run | 000510SMH | X | 2323 | N CHAMBLISS ST | Easement | 04/16/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 000717SMH | X | 111 | DUKE ST | Parking Lot | 06/28/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 000919SMH | X | 1250 | SANGER AV | Sidewalk | 07/06/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001219SMH | X | 486 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001526IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001534IN | X | 5904 | JEWELL CT | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001535IN | X | 2323 | N CHAMBLISS ST | Parking Lot | 04/16/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001940IN | X | 1460 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001948IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001956IN | X | 5703 | RAYBURN AV | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001960IN | X | 5600 | RAYBURN AV | Sidewalk | 04/24/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001962IN | X | 5683 | RAYBURN AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001963IN | X | 5669 | RAYBURN AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 001964IN | X | 5671 | RAYBURN AV | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001975IN | X | 5601 | HARDING AV | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001977IN | X | 5609 | HARDING AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 001982IN | X | 5614 | HARDING AV | Sidewalk | 04/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001983IN | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002001IN | X | 2001 | MARK CENTER DR | Sidewalk | 07/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002010IN | X | 1459 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002029IN | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 002119IN | X | 4520 | DUKE ST | Parking Lot | 07/25/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002124IN | X | 127 | DUKE ST | Parking Lot | 06/28/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002178IN | X | 103 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002179IN | X | 103 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002203IN | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002279IN | X | 161 | INGLE PL | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002280IN | X | 4636 | TANEY AV | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002298IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002672IN | X | 4505 | PEACOCK AV | Sidewalk | 06/13/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002778IN | X | 6206 | N MORGAN ST | Sidewalk | 04/27/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002818IN | X | 5928 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002821IN | X | 1130 | N BEAUREGARD ST | Yard-Side | 05/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002912IN | X | 6054 | MORGAN CT | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 002914IN | X | 6026 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002915IN | X | 6026 | N BEAUREGARD ST | Easement | 05/03/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002943IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002944IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002947IN | X | 6216 | MORGAN ST N | Easement | 08/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002950IN | X | 1250 | SANGER AV | Curb/Gutter | 07/06/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 002957IN | X | 5900 | SANGER AV | Easement | 05/08/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002960IN | X | 5900 | SANGER AV | Sidewalk | 05/08/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 002961IN | X | 5900 | SANGER AV | Parking Lot | 05/08/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 002971IN | X | 5431 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 003152IN | X | 5324 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003153IN | X | 5335 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003167IN | X | 5318 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003168IN | X | 5208 | RICHENBACHER AV | Sidewalk | 06/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003206IN | X | 741 | N PEGRAM ST | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003214IN | X | 5111 | SUTTON PL | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003282IN | X | 5350 | TANEY AV | Sidewalk | 05/16/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003340IN | X | 5500 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003813IN | X | 4907 | RUTLAND PL | Sidewalk | 05/29/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003826IN | X | 5340 | HOLMES RUN PY | Sidewalk | 05/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003827IN | X | 301 | N PAXTON ST | Sidewalk | 05/23/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003855IN | X | 5340 | DUKE ST | Parking Lot | 06/11/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003878IN | X | 175 | PAXTON ST N | Parking Lot | 10/19/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003908IN | X | 301 | N RIPLEY ST | Sidewalk | 05/22/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|-----------------------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 003913IN | X | 5425 | N RIPLEY ST | Sidewalk | 06/11/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003914IN | X | 5425 | DUKE ST | Sidewalk | 06/11/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 003919IN | X | 100 | RIPLEY ST N | Light Highway Rural Streets | 08/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003946IN | X | 5140 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003947IN | X | 101 | S PICKET ST | Driveway | 06/19/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 003959IN | X | 5350 | DUKE ST | Sidewalk | 06/20/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004073IN | X | 25 | S PICKET ST | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 004077IN | X | 5150 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Complete Inspection | 37 | 37 | 0 | 0 | 3 |
| Holmes Run | 004325IN | X | 6130 | N BRECKINRIDGE PL | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 004666IN | X | 5498 | N MORGAN ST | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004667IN | X | 5498 | N MORGAN ST | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004668IN | X | 1221 | N MORGAN ST | Parking Lot | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004669IN | X | 1221 | N MORGAN ST | Parking Lot | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 004709IN | X | 5851 | QUANTRELL AV | Parking Lot | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004719IN | X | 6000 | QUANTRELL AV | Sidewalk | 05/04/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004752IN | X | 5400 | N ARMISTEAD ST | Yard-Back | 07/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004756IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 004758IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 004759IN | X | 5851 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 4 |
| Holmes Run | 004785IN | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | Truck 1 | Complete Inspection | 37 | 38 | 0 | 0 | 2 |
| Holmes Run | 000274IO | X | 501 | HOLMES RUN PY | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 30 | 0 | 30 | 0 | 1 |
| Holmes Run | 001224SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 29 | 29 | 0 | 0 | 3 |
| Holmes Run | 003207IN | X | 701 | N PEGRAM ST | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 26 | 26 | 0 | 0 | 2 |
| Holmes Run | 003215IN | X | 611 | N PEGRAM ST | Sidewalk | 05/18/2012 | Truck 1 | Complete Inspection | 26 | 26 | 0 | 0 | 3 |
| Holmes Run | 004058SMH | X | 4601 | STRATHBLANE PL | Yard-Back | 10/19/2012 | Truck 1 | Complete Inspection | 18 | 19 | 0 | 0 | 2 |
| Holmes Run | 002726IN | X | 900 | N JORDAN ST | Easement | 06/14/2012 | Truck 1 | Complete Inspection | 15 | 15 | 0 | 0 | 2 |
| Holmes Run | 003277IN | X | 702 | N PELHAM ST | Sidewalk | 05/16/2012 | Truck 1 | Complete Inspection | 15 | 15 | 0 | 0 | 1 |
| Holmes Run | 004786IN | X | 723 | ASHTON ST N | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 15 | 0 | 15 | 0 | 1 |
| Holmes Run | 004787IN | X | 723 | ASHTON ST N | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 15 | 0 | 15 | 0 | 2 |
| Holmes Run | 004788IN | X | 705 | ASHTON ST N | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 15 | 0 | 15 | 0 | 3 |
| Holmes Run | 004789IN | X | 705 | ASHTON ST N | Sidewalk | 10/18/2012 | Truck 1 | Complete Inspection | 15 | 0 | 15 | 0 | 1 |
| Holmes Run | 002952IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | Truck 1 | Complete Inspection | 14 | 14 | 0 | 0 | 3 |
| Holmes Run | 004068IN | X | 25 | S PICKET ST | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 2 | 0 | 2 | 0 | 2 |
| Holmes Run | 000109IO | X | 1521 | CHAMBLISS ST N | Easement | 08/14/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|----------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000110IO | X | 1516 | CHAMBLISS ST N | Easement | 08/14/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000111IO | X | 5904 | JEWELL CT | Easement | 04/24/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000112IO | X | 2301 | N CHAMBLISS ST | Easement | 04/16/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000113IO | X | 2510 | N SCOTT ST | Easement | 07/31/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000116IO | X | 1900 | N BEAUREGARD ST | Easement | 07/31/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000117IO | X | 2323 | N CHAMBLISS ST | Easement | 04/16/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| HOLMES RUN | 000136IO | X | 2000 | BEAUREGARD ST N | Easement | 08/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000138IO | X | 5614 | N BEAUREGARD ST | Easement | 04/16/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000139IO | X | 5000 | SEMINARY RD | Easement | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000140IO | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000141IO | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000144IO | X | 1461 | N BEAUREGARD ST | | 07/31/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000145IO | X | 5000 | SEMINARY RD | Easement | 07/03/2012 | Truck 1 | Not Inspected - | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000149IO | X | 127 | DUKE ST | Easement | 06/28/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000160IO | X | 4600 | DUKE ST | Easement | 06/28/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000162IO | X | 4600 | DUKE ST | | 06/29/2012 | Truck 1 | Not Inspected - No | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000166IO | X | 4630 | N JORDAN ST | Easement | 05/31/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000187IO | X | 6056 | SANGER AV | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000189IO | X | 1201 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000191IO | X | 5875 | LOWELL AV | Easement | 04/30/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000193IO | X | 1201 | N BEAUREGARD ST | Easement | 05/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000196IO | X | 1221 | SANGER AV | Easement | 04/25/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000199IO | X | 5501 | SANGER AV | Easement | 05/08/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000204IO | X | 5079 | POLK AV | Easement | 06/01/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000206IO | X | 5367 | HOLMES RUN PY | Easement | 05/16/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000207IO | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000209IO | X | 5501 | HOLMES RUN PY | Easement | 05/14/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000211IO | X | 5489 | N RIPLEY ST | Easement | 05/22/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000212IO | X | 631 | N VAN DORN ST | Easement | 05/09/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000229ND | X | 1519 | CHAMBLISS ST N | | 08/14/2012 | Truck 1 | Not Inspected - No | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000261IO | X | 5319 | HOLMES RUN PY | Easement | 05/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000262IO | X | 501 | N PEGRAM ST | Easement | 05/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000263IO | X | 5109 | N PICKETT ST | Easement | 05/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000266IO | X | 327 | N PICKETT ST | Easement | 05/29/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000268IO | X | 327 | N PICKETT ST | Easement | 05/29/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000269IO | X | 5340 | HOLMES RUN PY | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000270IO | X | 5219 | N PAXTON ST | Easement | 05/23/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000272ND | X | 5014 | GARDNER DR | | 10/19/2012 | Truck 1 | Not Inspected - No | 0 | 0 | 0 | 0 | 0 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------------|------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000277IO | X | 299 | N PICKETT ST | Easement | 06/11/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000329IO | X | 1221 | N MORGAN ST | Easement | 05/04/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000330IO | X | 5499 | N MORGAN ST | Easement | 07/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000643SMH | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000653SMH | X | 5703 | RAYBURN AV | | 07/31/2012 | Truck 1 | Not Inspected - Other | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000666SMH | X | 1801 | SEMINARY RD | Building | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 4 |
| Holmes Run | 000668SMH | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000671SMH | X | 2000 | SEMINARY RD | | 07/03/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000673SMH | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000760SMH | X | 4601 | N JORDAN ST | Yard-Front | 05/31/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000767SMH | X | 901 | N JORDAN ST | | 07/26/2012 | Truck 1 | Not Inspected - Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000769SMH | X | 320 | N JORDAN ST | | 07/05/2012 | Truck 1 | Not Inspected - Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000778SMH | X | 4510 | DUKE ST | | 07/26/2012 | Truck 1 | Not Inspected - Other | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000779SMH | X | 4513 | DUKE ST | | 07/26/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000890SMH | X | 1106 | N HOWARD ST | | 06/14/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000901SMH | X | 827 | N BEAUREGARD ST | | 05/03/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000956SMH | X | 4505 | PEACOCK AV | | 06/13/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001012SMH | X | 1250 | SANGER AV | | 07/05/2012 | Truck 1 | Not Inspected - Buried | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001047SMH | X | 972 | N PEGRAM ST | | 07/31/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001048SMH | X | 918 | N PEGRAM ST | Yard-Back | 07/11/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001049SMH | X | 1056 | N PEGRAM ST | Yard-Back | 07/11/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001242SMH | X | 100 | RIPLEY ST N | | 08/17/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001260SMH | X | 5340 | HOLMES RUN PY | | 07/31/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 001371SMH | X | 101 | S VAN DORN ST | | 07/24/2012 | Truck 1 | Not Inspected - Other | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001500SMH | X | 205 | N BRECKINRIDGE PL | | 06/18/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001905IN | X | 2000 | BEAUREGARD ST N | Sidewalk | 08/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 001909IN | X | 2000 | BEAUREGARD ST N | | 08/17/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 002021IN | X | 5000 | SEMINARY RD | Sidewalk | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002022IN | X | 5000 | SEMINARY RD | Sidewalk | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002023IN | X | 5000 | SEMINARY RD | Yard-Side | 07/03/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002172IN | X | 4920 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002180IN | X | 4725 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002253IN | X | 4604 | STRATHBLANE PL | Yard-Back | 05/31/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 002292IN | X | 4510 | DUKE ST | Sidewalk | 07/26/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002297IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002727IN | X | 900 | N HOWARD ST | | 06/14/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Crew | Status / Why Not Inspected | Total MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-------------------|-------------|----------------------------|---------|----------------------------|----------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 002746IN | X | 904 | N HOWARD ST | | 06/14/2012 | Truck 1 | Not Inspected - Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 003135IN | X | 1134 | POLK AV | Easement | 06/01/2012 | Truck 1 | Not Inspected - Sealed | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 003136IN | X | 1107 | N PEGRAM ST | Easement | 06/01/2012 | Truck 1 | Not Inspected - Sealed | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 003183IN | X | 800 | N PRYOR ST | Yard-Back | 07/11/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 4 |
| Holmes Run | 003185IN | X | 706 | N PRYOR ST | Yard-Back | 07/11/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 003902IN | X | 5109 | N PICKETT ST | Sidewalk | 05/17/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003948IN | X | 5150 | DUKE ST | Sidewalk | 06/19/2012 | Truck 1 | Not Inspected - No | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003958IN | X | 5311 | DUKE ST | Parking Lot | 06/19/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003971IN | X | 30 | S REYNOLD ST | Sidewalk | 06/20/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 004069IN | X | 25 | S PICKETT ST | Sidewalk | 06/18/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 004330IN | X | 201 | N BRECKINRIDGE PL | Easement | 07/24/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 004664IN | X | 6130 | LINCOLNIA RD | Sidewalk | 08/14/2012 | Truck 1 | Not Inspected - Debris | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 004665IN | X | 479 | N MORGAN ST | Easement | 07/17/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 004726IN | X | 5851 | N ARMISTEAD ST | Easement | 07/17/2012 | Truck 1 | Not Inspected - No | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 004757IN | X | 435 | N ARMISTEAD ST | | 07/17/2012 | Truck 1 | Not Inspected - Not | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 009080IN | X | 4510 | DUKE ST | Sidewalk | 10/19/2012 | Truck 1 | Complete Inspection | 0 | 0 | 0 | 0 | 2 |

Appendix B – Structure Inspection Report
(Includes Defect Detail)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

Alexandria - Holmes Run

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|----------|----------------------------|----------------------------|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000109IO | X | 1521 | CHAMBLISS ST N | Easement | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000110IO | X | 1516 | CHAMBLISS ST N | Easement | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000111IO | X | 5904 | JEWELL CT | Easement | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000112IO | X | 2301 | N CHAMBLISS ST | Easement | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000113IO | X | 2510 | N SCOTT ST | Easement | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000116IO | X | 1900 | N BEAUREGARD ST | Easement | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000117IO | X | 2323 | N CHAMBLISS ST | Easement | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| HOLMES RUN | 000136IO | X | 2000 | BEAUREGARD ST N | Easement | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000138IO | X | 5614 | N BEAUREGARD ST | Easement | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000139IO | X | 5000 | SEMINARY RD | Easement | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000140IO | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000141IO | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000144IO | X | 1461 | N BEAUREGARD ST | | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000145IO | X | 5000 | SEMINARY RD | Easement | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | Surcharge | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000149IO | X | 127 | DUKE ST | Easement | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000160IO | X | 4600 | DUKE ST | Easement | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000162IO | X | 4600 | DUKE ST | | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | No Access | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000166IO | X | 4630 | N JORDAN ST | Easement | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000187IO | X | 6056 | SANGER AV | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000189IO | X | 1201 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000191IO | X | 5875 | LOWELL AV | Easement | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000193IO | X | 1201 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000196IO | X | 1221 | SANGER AV | Easement | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000199IO | X | 5501 | SANGER AV | Easement | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000204IO | X | 5079 | POLK AV | Easement | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000206IO | X | 5367 | HOLMES RUN PY | Easement | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000207IO | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|----------------|----------|----------------------------|----------------------------|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000209IO | X | 5501 | HOLMES RUN PY | Easement | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000211IO | X | 5489 | N RIPLEY ST | Easement | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000212IO | X | 631 | N VAN DORN ST | Easement | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000229ND | X | 1519 | CHAMBLISS ST N | | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | No Access | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000261IO | X | 5319 | HOLMES RUN PY | Easement | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000262IO | X | 501 | N PEGRAM ST | Easement | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000263IO | X | 5109 | N PICKETT ST | Easement | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000266IO | X | 327 | N PICKETT ST | Easement | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000268IO | X | 327 | N PICKETT ST | Easement | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000269IO | X | 5340 | HOLMES RUN PY | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000270IO | X | 5219 | N PAXTON ST | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000272ND | X | 5014 | GARDNER DR | | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | No Access | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000274IO | X | 501 | HOLMES RUN PY | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 30 | 0 | 30 | 0 | 1 |

| 3/8"-3/4" (1-2cm) runners, tap root, | | | | | | | | | | | | | | | |
|--------------------------------------|----------|---|------|--------------|-----------|----------------------------|----------------------------|---------|---|--|----|----|---|---|---|
| Holmes Run | 000277IO | X | 299 | N PICKETT ST | Easement | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000329IO | X | 1221 | N MORGAN ST | Easement | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000330IO | X | 5499 | N MORGAN ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 1 |
| Holmes Run | 000339ND | X | 6020 | NAGY PL | Yard-Back | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 2 |

| | | | | | | | | | | | | | | | | | |
|------------|-----------|---|--|------|---------------------------------|---------------|----------------------------|----------------------------|---------|---|--|--|----|----|---|---|---|
| Holmes Run | 000503SMH | X | | 1519 | CHAMBLISS ST N Rural Streets | Light Highway | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | | 56 | 57 | 0 | 0 | 3 |
|------------|-----------|---|--|------|---------------------------------|---------------|----------------------------|----------------------------|---------|---|--|--|----|----|---|---|---|

| | | | |
|-----------------|---------------------------|--|------------|
| Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural |
| Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I |
| Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural |
| Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural |
| Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|----------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000507SMH | X | 6000 | JEWELL CT | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000508SMH | X | 5916 | JEWELL CT | Light Highway Rural Streets | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 |
| Holmes Run | 000509SMH | X | 2323 | N CHAMBLISS ST | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000510SMH | X | 2323 | N CHAMBLISS ST | Easement | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 53 | 54 | 0 | 0 | 2 |
| Holmes Run | 000527SMH | X | 5628 | GARY AV | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000527SMH | X | 5628 | GARY AV | Light Highway Rural Streets | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|--|------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000528SMH | X | 5631 | GARY AV | Light Highway Rural Streets | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 3 |
| Holmes Run | 000573SMH | X | 2456 | N BEAUREGARD ST | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural | | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | |
| | | | | | | | | | | | | | | | |
| Holmes Run | 000642SMH | X | 2000 | SEMINARY RD | Light Highway Rural Streets | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 3 |
| Holmes Run | 000642SMH | X | 2000 | SEMINARY RD | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | |
| | | | | | | | | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|--|---------------------------|--|------------|-----------------|--------------------------------|----------------------------|----------------------------|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|-----------------|------------------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|-----------------|---------------------------|---|------------|--|--|--|--|--|--|--|--|--|--|--|--|-----------------|------------------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|--------------|---------------------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|--------------|--------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|--------------|---------------------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|---------|---------------------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|---------|--------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|---------|--------------|--|------------|--|--|--|--|--|--|--|--|--|--|--|--|
| Holmes Run | 000643SMH | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 000645SMH | X | 1851 | N BEAUREGARD ST | Sidewalk | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 81 | 81 | 0 | 0 | 3 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| <table border="1"> <tr> <td>Frame Base Seal</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td>Extreme: >50% mat'l loss, >3/4" (2cm) etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td>Extreme: >3/4" (20mm) width</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td>Mod: 10-25% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td>Mod: 1/16" to 1/8" (2-3mm) width, small pieces</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Frame Base Seal | Corroded, pitted, spalled | Extreme: >50% mat'l loss, >3/4" (2cm) etching | Structural | | | | | | | | | | | | | Frame Base Seal | Cracked / deteriorated | Extreme: >3/4" (20mm) width | Structural | | | | | | | | | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | Structural | | | | | | | | | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | | | | | | | | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | Corroded, pitted, spalled | Extreme: >50% mat'l loss, >3/4" (2cm) etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | Cracked / deteriorated | Extreme: >3/4" (20mm) width | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 000647SMH | X | 1851 | N BEAUREGARD ST | Light Highway Rural Streets | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| <table border="1"> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, <3/8" (1cm) etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural | | | | | | | | | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | |
| Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 000653SMH | X | 5703 | RAYBURN AV | | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | Other | 0 | 0 | 0 | 0 | 0 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 000654SMH | X | 5703 | N BEAUREGARD ST | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| <table border="1"> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, <3/8" (1cm) etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Frame Base Seal</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural | | | | | | | | | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|--------------------------------|--|-------------------|------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | | |
| Holmes Run | 000655SMH | X | 5601 | HARDING AV | Light Highway Rural Streets | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 4 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000656SMH | X | 5601 | HARDING AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 43 | 44 | 0 | 0 | 2 |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000659SMH | X | 2301 | N SIBLEY ST | Light Highway Rural Streets | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000661SMH | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000662SMH | X | 5614 | N BEAUREGARD ST | Parking Lot | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 53 | 55 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000663SMH | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 43 | 44 | 0 | 0 | 2 |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000666SMH | X | 1801 | SEMINARY RD | Building | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 4 |
| Holmes Run | 000668SMH | X | 2001 | N BEAUREGARD ST | Easement | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000669SMH | X | 5703 | N BEAUREGARD ST | Easement | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| | | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 000670SMH | X | 5900 | SANGER AV | Light Highway Rural Streets | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|-----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000671SMH | X | 2000 | SEMINARY RD | | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000672SMH | X | 1461 | N BEAUREGARD ST | Easement | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000673SMH | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 000680SMH | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 82 | 82 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Mod: 10-25% of area | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Bricks displaced or missing | Mod: 5-20% of area | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000681SMH | X | 4600 | DUKE ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 65 | 66 | 0 | 0 | 4 |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chimney/Shft | Bricks displaced or missing | Min: <5% of area | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000682SMH | X | 103 | BRENMAN PARK DR | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000683SMH | X | 103 | BRENMAN PARK DR | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000715SMH | X | 4520 | DUKE ST | Light Highway Rural Streets | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000716SMH | X | 95 | DUKE ST | Parking Lot | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 3 |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000717SMH | X | 111 | DUKE ST | Parking Lot | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000743SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000744SMH | X | 4725 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 4 |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000747SMH | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 3 |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|------------------------------------|---|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000748SMH | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 62 | 63 | 0 | 0 | 3 |
| Holmes Run | 000749SMH | X | 4600 | DUKE ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Steps | Broken / missing / deteriorated | Mod: 2-4 broken, missing | | Structural | | | | | | |
| | | | | | Sidewalk | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000752SMH | X | 491 | N OWEN ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | | | | | | | 54 | 55 | 0 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|----------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000759SMH | X | 4630 | RALEIGH AV | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | |
| Holmes Run | 000760SMH | X | 4601 | N JORDAN ST | Light Highway Rural Streets | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | 57 | 58 | 0 | 0 | 3 |
| Holmes Run | 000763SMH | X | 320 | N JORDAN ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 000764SMH | X | 320 | N JORDAN ST | Yard-Front | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000763SMH | X | 320 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 58 | 60 | 0 | 0 | 5 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 000764SMH | X | 320 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 58 | 60 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Steps | Corroded, pitted, spalled | Min: etching spotty, 1/16" to 1/8" (2-3mm) depth | | Structural | | | | | | |
| Holmes Run | 000765SMH | X | 4636 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000766SMH | X | 800 | N JORDAN ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 58 | 60 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Steps | Corroded, pitted, spalled | Min: etching spotty, 1/16" to 1/8" (2-3mm) depth | | | Structural | | | | | | |
| Holmes Run | 000767SMH | X | 901 | N JORDAN ST | | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000768SMH | X | 901 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000769SMH | X | 320 | N JORDAN ST | | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000773SMH | X | 4520 | DUKE ST | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 54 | 54 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 000774SMH | X | 4520 | DUKE ST | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 57 | 58 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000775SMH | X | 4520 | DUKE ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------|-----------------------------|-----------------------------|--|----------------------------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000776SMH | X | 4520 | DUKE ST | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | DUKE ST | Light Highway Rural Streets | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | | | | |
| Holmes Run | 000778SMH | X | 4510 | DUKE ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | 0 | 0 | 0 | 0 | 0 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | DUKE ST | | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | Other | 0 | 0 | 0 | 0 |
| Holmes Run | 000779SMH | X | 4513 | DUKE ST | | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000843SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 2 |
| Holmes Run | 000844SMH | X | 4510 | DUKE ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | 0 | 0 | 0 | 0 | 0 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 000878SMH | X | 1121 | SEMINARY RD | Easement | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 4 |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000890SMH | X | 1106 | N HOWARD ST | | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000901SMH | X | 827 | N BEAUREGARD ST | | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 000902SMH | X | 5864 | LOWELL AV | Light Highway Rural Streets | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 62 | 63 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| Holmes Run | 000903SMH | X | 6212 | N MORGAN ST | Driveway | 04/27/2012 | 04/27/2012 | Truck 1 | 1 | | 71 | 71 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | | | | | | |
|------------|-----------|-------------|----------|-----------------|-----------------|---------------------------|--|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|----|---|---|---|--|--|
| Holmes Run | 000904SMH | X | 6066 | MORGAN CT | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| Holmes Run | 000905SMH | X | 6042 | MORGAN CT | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | 79 | 80 | 0 | 0 | 2 | | | | | | | |
| Holmes Run | 000906SMH | X | 1131 | N BEAUREGARD ST | Frame Base Seal | Corroded, pitted, spalled | Extreme: >50% mat'l loss, >3/4" (2cm) etching | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| Holmes Run | 000906SMH | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | | | | | 56 | 57 | 0 | 0 | 2 | | |
| Holmes Run | 000906SMH | X | 1131 | N BEAUREGARD ST | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000909SMH | X | 5875 | LOWELL AV | Easement | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 68 | 69 | 0 | 0 | 2 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Bench | Cracked | Extreme: >1/4" (6mm) width, pieces, missing | | Structural | | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Extreme: >50% mat'l loss, >3/4" (2cm) etching | | Structural | | | | | | | |
| | | | | Bench | Mortar missing | Min: <10% of area | | Structural | | | | | | | |
| | | | | Channel | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| Holmes Run | 000910SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| Holmes Run | 000912SMH | X | 1250 | N BEAUREGARD ST | Light Highway Rural Streets | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 3 |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000914SMH | X | 5700 | SANGER AV | Yard-Side | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000915SMH | X | 5700 | SANGER AV | Yard-Side | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000916SMH | X | 1201 | SANGER AV | Light Highway Rural Streets | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000917SMH | X | 1250 | SANGER AV | Light Highway Rural Streets | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------|--------------------------------|---------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000918SMH | X | 1250 | SANGER AV | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| Holmes Run | 000919SMH | X | 1250 | SANGER AV | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 000919SMH | X | 1250 | SANGER AV | Sidewalk | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 000920SMH | X | 1201 | SANGER AV | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 000920SMH | X | 1201 | SANGER AV | Light Highway Rural Streets | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 67 | 68 | 0 | 0 | 2 |
| | | | | | Frame | Corroded, pitted, spalled | Mod: generally etching, 1/8" to 3/16" (3-5mm) depth | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | | I/I | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|----------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000921SMH | X | 1221 | SANGER AV | Yard-Front | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000922SMH | X | 4703 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 58 | 59 | 0 | 0 | 5 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000923SMH | X | 4801 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000924SMH | X | 503 | N MANSFIELD ST | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 53 | 55 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000928SMH | X | 505 | NAYLOR ST N | Light Highway Rural Streets | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000929SMH | X | 503 | NAYLOR ST N | Light Highway Rural Streets | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 2 |
| | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000930SMH | X | 500 | N NAYLOR ST | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 3 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000931SMH | X | 4806 | TANEY AV | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 63 | 64 | 0 | 0 | 5 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|--------------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-3 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-5 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000933SMH | X | 497 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 60 | 61 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Bench | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000934SMH | X | 501 | N OWEN ST | Light Highway Rural Streets | 05/30/2012 | 05/30/2012 | Truck 1 | 1 | | 62 | 62 | 20 | 0 | 5 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|--------------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Pipe Connection-2 | Roots Intrusion | Mod: 1/16" to 1/8" (2-3mm) dia. fingers, ~3/8" (1cm) dia. runner | | | Maintenance | | | | | | |
| Holmes Run | 000937SMH | X | 504 | OWEN ST N | Light Highway Rural Streets | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000945SMH | X | 703 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000946SMH | X | 701 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|--------------|--------------------------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000947SMH | X | 609 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 000948SMH | X | 607 | N PICKETT ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000949SMH | X | 513 | N PICKETT ST | Light Highway Rural Streets | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 65 | 57 | 48 | 0 | 3 |
| Holmes Run | 000949SMH | X | 513 | N PICKETT ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000949SMH | X | 513 | N PICKETT ST | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Pipe Connection-2 | Roots Intrusion | Maj: 1/8"-3/16" (3-5mm) dia. fingers, 3/8"-3/4" (1-2cm) runners, tap root, | | Maintenance | | | | | | |
| | | | | | Pipe Connection-3 | Roots Intrusion | Maj: 1/8"-3/16" (3-5mm) dia. fingers, 3/8"-3/4" (1-2cm) runners, tap root, | | Maintenance | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|--------------|--------------------------------|---------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 000950SMH | X | 509 | N PICKETT ST | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| Holmes Run | 000951SMH | X | 5001 | TANEY AV | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 65 | 66 | 0 | 0 | 4 |
| Holmes Run | 000956SMH | X | 4505 | PEACOCK AV | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | Truck 1 | 1 | | Not found | 0 | 0 | 0 | 0 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | | | | | | |
| | | | | | Bench | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | | | | | | |
| | | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Pipe Connection-3 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| Holmes Run | 000957SMH | X | 907 | KEMPER ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | 1 | | Not found | 0 | 0 | 0 | 0 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|-----------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 000958SMH | X | 919 | KEMPER ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 000961SMH | X | 4500 | PEACOCK AV | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 000962SMH | X | 800 | N JORDAN ST | Yard-Front | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 67 | 66 | 20 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Mortar missing | Min: <10% of area | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | |
|------------|-----------|----------------|----------|-------------|--------------------------------|--|---|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|--|
| Holmes Run | 000964SMH | X | 901 | JUNIPER PL | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | Roots Intrusion | Mod: 1/16"-1/8" (2-3mm) dia. fingers, ~3/8" (1cm) dia. runner | | | Maintenance | | | | | | |
| | | | | | Light Highway Rural Streets | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 66 | 67 | 0 | 0 | 3 | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | | |
| | | | | | Chimney/Shaft | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000969SMH | X | 5940 | LOWELL AV | Light Highway Rural Streets | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 4 | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000970SMH | X | 1125 | ANDERSON ST | Light Highway Rural Streets | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | |
|------------|-----------|----------------|----------|-------------|--------------------------------|--|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|--|
| Holmes Run | 000976SMH | X | 6212 | N MORGAN ST | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| Holmes Run | 000977SMH | X | 6140 | N MORGAN ST | Light Highway Rural Streets | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 000978SMH | X | 6108 | N MORGAN ST | Light Highway Rural Streets | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | Structural | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000979SMH | X | 6020 | NAGY PL | Light Highway Rural Streets | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chamber | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000981SMH | X | 6015 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chamber | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | Chamber | Mortar missing | | Min: <10% of area | | Structural | | | | | | |
| Holmes Run | 000982SMH | X | 6000 | MORGAN CT | Sidewalk | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 63 | 64 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | Chamber | Cracked | | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 000983SMH | X | 1130 | N BEAUREGARD ST | Parking Lot | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 4 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|-----------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000984SMH | X | 903 | N JORDAN ST | Parking Lot | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 68 | 69 | 0 | 0 | 2 |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Bricks displaced or missing | Min: <5% of area | | | Structural | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000985SMH | X | 903 | N JORDAN ST | Parking Lot | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000988SMH | X | 901 | N JORDAN ST | Light Highway Rural Streets | 07/02/2012 | 07/02/2012 | Truck 1 | 1 | | 57 | 58 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 000989SMH | X | 901 | JUNIPER PL | Light Highway Rural Streets | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 5 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 000994SMH | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 65 | 65 | 0 | 0 | 5 |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 000995SMH | X | 5445 | RICHENBACHER AV | Sidewalk | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-----------------------------|---------------------------|--|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 000996SMH | X | 5445 | RICHENBACHER AV | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 000997SMH | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 3 |
| Holmes Run | 000999SMH | X | 5402 | BARRISTER PL | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 000999SMH | X | 5402 | BARRISTER PL | Light Highway Rural Streets | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 73 | 66 | 40 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|-----------------|---------------------------|--|----------|--------------|-----------------------------|--|--|---------|-------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001000SMH | X | 5402 | BARRISTER PL | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | Roots Intrusion | Extreme: >3/16" (4mm) dia. fingers, >3/4" (2cm) runners or tap dia | | Maintenance | | | | | | |
| | | | | | | | | | | | | | | | |
| Holmes Run | 001000SMH | X | 5402 | BARRISTER PL | Parking Lot | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 70 | 71 | 0 | 0 | 3 |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | |
| | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | | | | | | |
| | Cracked / deteriorated | Maj: 3/8"-3/4" (10-20mm) width, pieces, missing | | Structural | | | | | | | | | | | |
| | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | | | | |
| | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | | | | | |
| | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | | | | | | |
| | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | | | | |
| | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | | | | | |
| | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | | | | | |
| Holmes Run | 001004SMH | X | 5418 | BARRISTER PL | Yard-Side | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 59 | 61 | 0 | 0 | 2 |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | |
| | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | | | | | | |
| | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | | | | | | |
| | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | | | | | |
| | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | | | | |
| | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | | | | | |
| | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | | | | | |
| | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | | | | | |
| | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | | | | | |
| | | | | | | | | | | | | | | | |
| Holmes Run | 001005SMH | X | 1148 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 69 | 69 | 5 | 0 | 3 |
| Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | |
| | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|-------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Mortar missing | Maj: 25-50% of area | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 001006SMH | X | 1148 | POLK AV | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 001007SMH | X | 5079 | POLK AV | Light Highway Rural Streets | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 2 |
| Holmes Run | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001008SMH | X | 1321 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 62 | 64 | 0 | 0 | 3 |
| Holmes Run | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|---------------------------|--|------------|---------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001009SMH | X | 1340 | N PEGRAM ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Steps | Corroded, pitted, spalled | Mod: generally etching, 1/8" to 3/16" (3-5mm) depth | | | Structural | | | | | |
| | | | | | | | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 |
| Holmes Run | 001010SMH | X | 1221 | SANGER AV | Light Highway Rural Streets | | | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 001011SMH | X | 1221 | SANGER AV | Light Highway Rural Streets | | | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | | | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|--------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001012SMH | X | 1250 | SANGER AV | | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | Buried and Marked | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001043SMH | X | 495 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001044SMH | X | 487 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001045SMH | X | 5101 | TANEY AV | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001046SMH | X | 741 | N PEGRAM ST | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001047SMH | X | 972 | N PEGRAM ST | | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001048SMH | X | 918 | N PEGRAM ST | Yard-Back | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001049SMH | X | 1056 | N PEGRAM ST | Yard-Back | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001050SMH | X | 708 | N PEGRAM ST | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 69 | 69 | 0 | 0 | 2 |
| Holmes Run | 001051SMH | X | 5308 | TANEY AV | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001051SMH | X | 5308 | TANEY AV | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 68 | 69 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | |
| Holmes Run | 001052SMH | X | 5308 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001054SMH | X | 5312 | N PAXTON ST | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 6 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001055SMH | X | 610 | TRUMAN AV | Light Highway Rural Streets | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 65 | 66 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-------------|-----------------------------|---------------------------|--|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001057SMH | X | 5312 | N PAXTON ST | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Light Highway Rural Streets | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | | | | | 56 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | 57 | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | 0 | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | 0 | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | 6 | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 001058SMH | X | 518 | N PAXTON ST | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | 61 | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | 62 | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | 0 | | | | |
| | | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | 0 | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | 3 | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| Holmes Run | 001061SMH | X | 5328 | TANEY AV | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | 0 | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | 0 | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | 3 | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | |
|------------|-----------|----------------|----------|---------------|--------------------------------|--------------------------------|---|----------------------------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|---|
| Holmes Run | 001063SMH | X | 5367 | HOLMES RUN PY | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 | |
| Holmes Run | 001064SMH | X | 511 | N PELHAM ST | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | N PELHAM ST | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 001065SMH | X | 607 | N PELHAM ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | N PELHAM ST | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 68 | 60 | 35 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 001067SMH | X | 5355 | TRUMAN AV | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 99 | 99 | 15 | 0 | 4 |
| | | | | Cover | Cracked / deteriorated | Extreme: separating into pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 001069SMH | X | 5350 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001071SMH | X | 5402 | TANEY AV | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 66 | 67 | 0 | 0 | 3 |
| | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 001072SMH | X | 709 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 99 | 99 | 0 | 0 | 3 |
| | | | | Cover | Cracked / deteriorated | Extreme: separating into pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001073SMH | X | 633 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 67 | 68 | 0 | 0 | 4 |
| | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001074SMH | X | 701 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 60 | 61 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001075SMH | X | 602 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 53 | 53 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001080SMH | X | 420 | N VAN DORN ST | Sidewalk | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001084SMH | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 3 |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001085SMH | X | 420 | HOLMES RUN PY | Easement | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|---|----------------------------|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shft | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Chamber | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| Holmes Run | 001088SMH | X | 5500 | HOLMES RUN PY | Easement | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| | | | | Chamber | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| Holmes Run | 001089SMH | X | 5500 | HOLMES RUN PY | Easement | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 43 | 44 | 0 | 0 | 2 |
| | | | | Chimney/Shft | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Chamber | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| Holmes Run | 001090SMH | X | 301 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 50 | 50 | 0 | 0 | 3 |
| | | | | Chimney/Shft | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Chamber | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| Holmes Run | 001096SMH | X | 851 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 3 |
| | | | | Chimney/Shft | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chamber | Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, Min: <10% mat'l loss, etching spalled | | | | Structural | | | | | | |
| Holmes Run | 001097SMH | X | 631 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| | | | | Frame Base Seal | Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001216SMH | X | 5319 | HOLMES RUN PY | Light Highway Rural Streets | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 58 | 59 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001217SMH | X | 5319 | HOLMES RUN PY | Light Highway Rural Streets | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 4 |
| | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001218SMH | X | 501 | N PEGRAM ST | Easement | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 |
| | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|-----------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001219SMH | X | 486 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001220SMH | X | 484 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 46 | 47 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001221SMH | X | 483 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001222SMH | X | 332 | N PICKETT ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001223SMH | X | 301 | N PAXTON ST | Light Highway Rural Streets | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 001224SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 29 | 29 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001225SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 2 |
| | | | | | Frame | Offset | Mod: 2" to 3" (5-7.5cm) | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001226SMH | X | 301 | N PAXTON ST | Easement | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 1 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001228SMH | X | 200 | N RIPLEY ST | Driveway | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 57 | 58 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|-----------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001229SMH | X | 200 | N RIPLEY ST | Driveway | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| Holmes Run | 001230SMH | X | 200 | N RIPLEY ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001231SMH | X | 200 | N RIPLEY ST | Easement | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 2 |
| Holmes Run | 001230SMH | X | 200 | N RIPLEY ST | Frame | Offset | Mod: 2" to 3" (5-7.5cm) | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001231SMH | X | 200 | N RIPLEY ST | Easement | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 46 | 46 | 0 | 0 | 2 |
| Holmes Run | 001230SMH | X | 200 | N RIPLEY ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|---------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001232SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001233SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 3 |
| | | | | Frame | Offset | Mod: 2" to 3" (5-7.5cm) | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001234SMH | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Frame | Offset | Min: 7/8" to 2" (2.5-5cm) | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001236SMH | X | 5425 | N RIPLEY ST | Yard-Side | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001237SMH | X | 5425 | N RIPLEY ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Sidewalk | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001238SMH | X | 5425 | N RIPLEY ST | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Yard-Side | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 72 | 73 | 0 | 0 | 2 |
| | | | | | Frame | Offset | Mod: 2" to 3" (5-7.5cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Maj: 3/8"-3/4" (10-20mm) width, pieces, missing | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001239SMH | X | 5425 | N RIPLEY ST | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Light Highway Rural Streets | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001241SMH | X | 100 | RIPLEY ST N | Light Highway Rural Streets | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 69 | 70 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Bricks displaced or missing | Min: <5% of area | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Mortar missing | Mod: 10-25% of area | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001242SMH | X | 100 | RIPLEY ST N | | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001244SMH | X | 5425 | N RIPLEY ST | Light Highway Rural Streets | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 4 |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001245SMH | X | 200 | N RIPLEY ST | Easement | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 6 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001248SMH | X | 488 | N OWEN ST | Light Highway Rural Streets | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 57 | 59 | 0 | 0 | 3 |
| Holmes Run | 001249SMH | X | 5425 | DUKE ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 001251SMH | X | 5125 | DUKE ST | Parking Lot | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 001251SMH | X | 5125 | DUKE ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001251SMH | X | 5125 | DUKE ST | Driveway | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 69 | 66 | 35 | 0 | 4 |
| Holmes Run | 001251SMH | X | 5125 | DUKE ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------------|--------------------------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | Maintenance | | | | | | |
| Holmes Run | 001255SMH | X | 301 | PAXTON ST N | Parking Lot | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001259SMH | X | 5340 | HOLMES RUN PY | Parking Lot | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001260SMH | X | 5340 | HOLMES RUN PY | | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 001267SMH | X | 5150 | DUKE ST | Light Highway Rural Streets | 07/31/2012 | 07/31/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------|-----------------------------|---------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001268SMH | X | 5150 | DUKE ST | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | | | | | 56 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 001269SMH | X | 5200 | DUKE ST | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 001271SMH | X | 5200 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | | | | | 64 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|-------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001272SMH | X | 5701 | DUKE ST | Light Highway Rural Streets | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | | 57 | 57 | 15 | 0 | 4 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 001273SMH | X | 100 | DUKE ST | Light Highway Rural Streets | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001274SMH | X | 5350 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------|--------------------------------|---------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001275SMH | X | 5311 | DUKE ST | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 001276SMH | X | 5220 | DUKE ST | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 001277SMH | X | 5220 | DUKE ST | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|--------------|--------------------------------|---------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001278SMH | X | 5350 | DUKE ST | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001279SMH | X | 5412 | DUKE ST | Light Highway Rural Streets | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001281SMH | X | 30 | S REYNOLD ST | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| | | | | | Driveway | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | S REYNOLD ST | | | | | | | | | | |
| | | | | | | | | | | 58 | 59 | 0 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001282SMH | X | 34 | A S REYNOLD ST | Yard-Back | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 3 |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001323SMH | X | 5990 | DUKE ST | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 72 | 73 | 0 | 0 | 4 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Maj: 3/8"-3/4" (10-20mm) width, pieces, missing | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Mortar missing | Mod: 10-25% of area | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001324SMH | X | 5990 | DUKE ST | Sidewalk | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001325SMH | X | 5990 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------------|-----------------|--------------------------------|--|------------|---------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001326SMH | X | 5990 | S VAN DORN ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | S VAN DORN ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | 51 | 52 | 0 | 0 | 3 |
| Holmes Run | 001328SMH | X | 5801 | DUKE ST | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | S VAN DORN ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | 56 | 57 | 0 | 0 | 4 |
| Holmes Run | 001340SMH | X | 5801 | DUKE ST | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | S VAN DORN ST | Light Highway Rural Streets | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | S VAN DORN ST | Light Highway Rural Streets | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | 56 | 57 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|---------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001341SMH | X | 5801 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001344SMH | X | 5990 | DUKE ST | Light Highway Rural Streets | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001371SMH | X | 101 | S VAN DORN ST | | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | Other | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001453SMH | X | 4550 | N PICKETT ST | Yard-Side | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 46 | 47 | 0 | 0 | 2 |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shaft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|--------------|-----------------------------|---------------------------------|--|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001454SMH | X | 1330 | N PICKETT ST | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Steps | Broken / missing / deteriorated | Min: 1-2 broken, missing | | | Structural | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Steps | Corroded, pitted, spalled | Min: etching spotty, 1/16" to 1/8" (2-3mm) depth | | | Structural | | | | | |
| Holmes Run | 001457SMH | X | 1465 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 64 | 65 | 0 | 0 | 3 |
| Holmes Run | 001458SMH | X | 1445 | SEMINARY RD | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| Holmes Run | 001459SMH | X | 1425 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001460SMH | X | 1425 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001461SMH | X | 1415 | SEMINARY RD | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001476SMH | X | 5425 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001479SMH | X | 1400 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 001480SMH | X | 1380 | N PEGRAM ST | Light Highway Rural Streets | 07/10/2012 | 07/10/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001499SMH | X | 301 | BEAUREGARD ST N | Driveway | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001500SMH | X | 205 | N BRECKINRIDGE PL | | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | Not Opened | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001502SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001503SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 1 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001504SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-------------------|---------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001505SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 62 | 63 | 0 | 0 | 2 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001507SMH | X | 205 | N BRECKINRIDGE PL | Parking Lot | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 4 |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001515SMH | X | 5851 | QUANTRELL AV | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001519SMH | X | 5400 | N ARMISTEAD ST | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001520SMH | X | 729 | QUANTRELL AV | Yard-Front | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 3 |
| Holmes Run | 001521SMH | X | 1131 | N BEAUREGARD ST | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001521SMH | X | 1131 | N BEAUREGARD ST | Light Highway Rural Streets | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|---------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001525IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 45 | 46 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001525SMH | X | 5800 | QUANTRELL AV | Yard-Side | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 49 | 50 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001526IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 001527IN | X | 1519 | CHAMBLISS ST N | Sidewalk | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 63 | 64 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001527SMH | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|-------------|----------|-----------------|-------------------|---------------------------|--|------------|--------------|--|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 001528SMH | X | 5925 | QUANTRELL AV | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | I/I evidence | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | 70 | 71 | 0 | 0 | 4 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Maj: 3/16"-1/4" (5-6mm) width | | | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Maj: 3/8"-3/4" (10-20mm) width, pieces, missing | | | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| Holmes Run | 001534IN | X | 5904 | JEWELL CT | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | Structural | I/I evidence | Mod: 10-25% mat'l loss, etching | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | N CHAMBLISS ST | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | 37 | 38 | 0 | 0 | 3 |
| Holmes Run | 001535IN | X | 2323 | N BEAUREGARD ST | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| Holmes Run | 001905IN | X | 2000 | BEAUREGARD ST N | Sidewalk | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 001909IN | X | 2000 | BEAUREGARD ST N | | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 001920IN | X | 1851 | N BEAUREGARD ST | Sidewalk | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 52 | 53 | 0 | 0 | 2 |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | Structural | I/I evidence | Min: <10% of area | 0 | 0 | 0 | 0 | 2 |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | | | | | | |
| | | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001921IN | X | 1851 | N BEAUREGARD ST | Easement | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 54 | 56 | 0 | 0 | 2 |
| | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| Holmes Run | 001940IN | X | 1460 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 001948IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 001950IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 43 | 44 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-3 | Pipe cracked | Mod: 1/8" to 3/16" (3-5mm) width | | | Structural | | | | | | |
| Holmes Run | 001952IN | X | 5650 | RAYBURN AV | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | | Structural | | | | | | |
| | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | | Structural | | | | | | |
| | | | | Pipe Connection-3 | Pipe cracked | Mod: 1/8" to 3/16" (3-5mm) width | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|------------|----------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 001956IN | X | 5703 | RAYBURN AV | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001960IN | X | 5600 | RAYBURN AV | Sidewalk | 04/24/2012 | 04/24/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001961IN | X | 5697 | RAYBURN AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001962IN | X | 5683 | RAYBURN AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001963IN | X | 5669 | RAYBURN AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001964IN | X | 5671 | RAYBURN AV | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 001975IN | X | 5601 | HARDING AV | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001977IN | X | 5609 | HARDING AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|-------------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001982IN | X | 5614 | HARDING AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001983IN | X | 5614 | N BEAUREGARD ST | Yard-Side | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001984IN | X | 5614 | N BEAUREGARD ST | Sidewalk | 04/16/2012 | 04/16/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 001985IN | X | 5612 | HARDING AV | Sidewalk | 04/23/2012 | 04/23/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002001IN | X | 2001 | MARK CENTER DR | Sidewalk | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 002008IN | X | 1459 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 48 | 44 | 10 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | Debris/deposition | Min: <1gal bucket | | Maintenance | | | | | | |
| | | | | | Channel | Debris/deposition | Min: <1gal bucket | | Maintenance | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | | Structural | | | | | | |
| Holmes Run | 002010IN | X | 1459 | N BEAUREGARD ST | Sidewalk | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002021IN | X | 5000 | SEMINARY RD | Sidewalk | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002022IN | X | 5000 | SEMINARY RD | Sidewalk | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002023IN | X | 5000 | SEMINARY RD | Yard-Side | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002029IN | X | 2000 | SEMINARY RD | Easement | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002030IN | X | 2000 | SEMINARY RD | Curb/Gutter | 07/03/2012 | 07/03/2012 | Truck 1 | 1 | | 42 | 38 | 5 | 0 | 2 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 002031IN | X | 1851 | N BEAUREGARD ST | Easement | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 54 | 56 | 0 | 0 | 2 |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002119IN | X | 4520 | DUKE ST | Parking Lot | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|-----------------------------|----------------------------|--|---------|------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 002124IN | X | 127 | DUKE ST | Parking Lot | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002172IN | X | 4920 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002173IN | X | 5000 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002178IN | X | 103 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002179IN | X | 103 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002180IN | X | 4725 | BRENMAN PARK DR | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 002195IN | X | 4600 | DUKE ST | Sidewalk | 06/28/2012 | 06/28/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| | | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 002203IN | X | 103 | BRENMAN PARK DR | Light Highway Rural Streets | 07/25/2012 | 07/25/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002225IN | X | 4601 | STRATHBLANE PL | Sidewalk | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|----------------|-----------------|----------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 002226IN | X | 4612 | STRATHBLANE PL | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Sidewalk | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | | | | | 45 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 002237IN | X | 4634 | TANEY AV | Sidewalk | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | | | | | 56 |
| Holmes Run | 002239IN | X | 4634 | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| Holmes Run | 002239IN | X | 4634 | | Sidewalk | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | | | | | 57 |
| Holmes Run | 002252IN | X | 4630 | RALEIGH AV | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | |
| | | | | | Sidewalk | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | | | | | | 62 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|----------------|-----------|----------------------------|--|---------|-------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 002253IN | X | 4604 | STRATHBLANE PL | Yard-Back | 05/31/2012 | 05/31/2012 | Truck 1 | 1 | Not Opened | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 002272IN | X | 320 | N JORDAN ST | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002279IN | X | 161 | INGLE PL | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 002280IN | X | 4636 | TANEY AV | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002292IN | X | 4510 | DUKE ST | Sidewalk | 07/26/2012 | 07/26/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002295IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 59 | 43 | 35 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | Maintenance | | | | | | |
| Holmes Run | 002296IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 2 |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002297IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 002298IN | X | 4513 | DUKE ST | Sidewalk | 06/29/2012 | 06/29/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-------------|-------------------|----------------------------|--|---------|-------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002562IN | X | 1121 | N HOWARD ST | Sidewalk | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 002672IN | X | 4505 | PEACOCK AV | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 002678IN | X | 919 | KEMPER ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002693IN | X | 800 | N JORDAN ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 68 | 68 | 5 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Steps | Corroded, pitted, spalled | Min: etching spotty, 1/16" to 1/8" (2-3mm) depth | | Structural | | | | | | |
| | | | | | Channel | Debris/deposition | Min: <1gal bucket | | Maintenance | | | | | | |
| | | | | | Pipe Connection-3 | Pipe cracked | Mod: 1/8" to 3/16" (3-5mm) width | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------|------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 002718IN | X | 903 | N JORDAN ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 54 | 54 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| Holmes Run | 002719IN | X | 903 | N JORDAN ST | Sidewalk | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 54 | 54 | 0 | 0 | 1 |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002723IN | X | 903 | N JORDAN ST | Yard-Front | 06/13/2012 | 06/13/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 4 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002726IN | X | 900 | N JORDAN ST | Easement | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 15 | 15 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002727IN | X | 900 | N HOWARD ST | | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 002729IN | X | 903 | N HOWARD ST | Sidewalk | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 43 | 38 | 15 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 002732IN | X | 903 | N HOWARD ST | Sidewalk | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002746IN | X | 904 | N HOWARD ST | | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 002778IN | X | 6206 | N MORGAN ST | Sidewalk | 04/27/2012 | 04/27/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002779IN | X | 6140 | N MORGAN ST | Sidewalk | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002786IN | X | 6108 | N MORGAN ST | Sidewalk | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002794IN | X | 835 | N ASHTON ST | Sidewalk | 04/27/2012 | 04/27/2012 | Truck 1 | 1 | | 42 | 38 | 5 | 0 | 4 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 002795IN | X | 830 | N ASHTON ST | Sidewalk | 04/27/2012 | 04/27/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 002797IN | X | 6008 | NAGY PL | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 42 | 38 | 5 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 002799IN | X | 830 | ASHTON ST N | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 1 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002801IN | X | 6040 | N MORGAN ST | Sidewalk | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|-------------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| | | | | | Pipe Connection-3 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002803IN | X | 6030 | N BEAUREGARD ST | Sidewalk | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 67 | 52 | 40 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-2 | Roots Intrusion | Extreme: >3/16" (4mm) dia. fingers, >3/4" (2cm) runners or tap dia | | Maintenance | | | | | | |
| | | | | | Pipe Connection-3 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002817IN | X | 6030 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-5 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002818IN | X | 5928 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 002819IN | X | 6000 | N BEAUREGARD ST | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 47 | 48 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|-----------------|--|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002820IN | X | 835 | N BEAUREGARD ST | Easement | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002821IN | X | 1130 | N BEAUREGARD ST | Yard-Side | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002822IN | X | 5909 | LOWELL AV | Sidewalk | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002824IN | X | 6116 | N MORGAN ST | Sidewalk | 04/30/2012 | 04/30/2012 | Truck 1 | 1 | | 55 | 56 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002828IN | X | 1118 | N HOWARD ST | Sidewalk | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Pipe Connection-1 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | | |
| Holmes Run | 002829IN | X | 1110 | N HOWARD ST | Sidewalk | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 46 | 46 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | I/I | | | | | | | |
| Holmes Run | 002906IN | X | 6056 | MORGAN CT | Easement | 05/02/2012 | 05/02/2012 | Truck 1 | 1 | | 50 | 50 | 0 | 0 | 4 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002912IN | X | 6054 | MORGAN CT | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| Holmes Run | 002914IN | X | 6026 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002915IN | X | 6026 | N BEAUREGARD ST | Easement | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002916IN | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | I/I | | | | | | | |
| Holmes Run | 002917IN | X | 1131 | N BEAUREGARD ST | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|----------------------------|-------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002923IN | X | 6054 | N MORGAN ST | Sidewalk | 05/03/2012 | 05/03/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002930IN | X | 1250 | SANGER AV | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 54 | 54 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | | |
| Holmes Run | 002932IN | X | 1250 | SANGER AV | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 58 | 50 | 35 | 0 | 1 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | Maintenance | | | | | | | |
| Holmes Run | 002939IN | X | 1250 | N BEAUREGARD ST | Sidewalk | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 002941IN | X | 1250 | N BEAUREGARD ST | Easement | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 99 | 99 | 0 | 0 | 3 |
| | | | | Cover | Cracked / deteriorated | Extreme: separating into pieces | | Structural | | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| Holmes Run | 002942IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Bench | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | | I/I | | | | | | |
| Holmes Run | 002943IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002944IN | X | 5700 | SANGER AV | Easement | 05/10/2012 | 05/10/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002945IN | X | 1250 | SANGER AV | Sidewalk | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002947IN | X | 6216 | MORGAN ST N | Easement | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 002950IN | X | 1250 | SANGER AV | Curb/Gutter | 07/06/2012 | 07/06/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 002951IN | X | 1221 | SANGER AV | Yard-Front | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002952IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 14 | 14 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| Holmes Run | 002953IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 4 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002954IN | X | 1221 | SANGER AV | Sidewalk | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 53 | 54 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002956IN | X | 5900 | SANGER AV | Sidewalk | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 002957IN | X | 5900 | SANGER AV | Easement | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 002960IN | X | 5900 | SANGER AV | Sidewalk | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 002961IN | X | 5900 | SANGER AV | Parking Lot | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|-------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 002962IN | X | 5501 | SANGER AV | Parking Lot | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 002963IN | X | 5501 | SANGER AV | Yard-Front | 05/08/2012 | 05/08/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002967IN | X | 5429 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 002971IN | X | 5431 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002983IN | X | 5418 | N VAN DORN ST | Sidewalk | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 68 | 69 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | |
| | | | | | Bench | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 002999IN | X | 5079 | POLK AV | Sidewalk | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 003004IN | X | 1250 | SANGER AV | Sidewalk | 04/25/2012 | 04/25/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|-----------------------------|----------------------------|--|---------|------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003011IN | X | 1250 | N BEAUREGARD ST | Sidewalk | 07/05/2012 | 07/05/2012 | Truck 1 | 1 | | 54 | 54 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| Holmes Run | 003017IN | X | 5445 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 003019IN | X | 5445 | RICHENBACHER AV | Light Highway Rural Streets | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 61 | 62 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003020IN | X | 5402 | N VAN DORN ST | Light Highway Rural Streets | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 62 | 63 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | |
|------------|----------|----------------|----------|-----------------|----------|----------------------------|--|---------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|--|
| | | | | | Channel | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003022IN | X | 5401 | BARRISTER PL | Sidewalk | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 45 | 38 | 10 | 0 | 3 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | | Bench | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| | | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 003023IN | X | 5408 | BARRISTER PL | Sidewalk | 06/08/2012 | 06/08/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 003133IN | X | 1148 | POLK AV | Easement | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 5 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 003134IN | X | 5079 | POLK AV | Sidewalk | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 4 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003135IN | X | 1134 | POLK AV | Easement | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | Sealed Lid | 0 | 0 | 0 | 0 | 0 | |
| Holmes Run | 003136IN | X | 1107 | N PEGRAM ST | Easement | 06/01/2012 | 06/01/2012 | Truck 1 | 1 | Sealed Lid | 0 | 0 | 0 | 0 | 0 | |
| Holmes Run | 003149IN | X | 1101 | PALMER PL | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 003152IN | X | 5324 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|-------------|----------|-----------------|-----------|----------------------------|--|---------|------------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|
| Holmes Run | 003153IN | X | 5335 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003167IN | X | 5318 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003168IN | X | 5208 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003169IN | X | 5200 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003171IN | X | 5102 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 53 | 54 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Channel | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003172IN | X | 5105 | RICHENBACHER AV | Sidewalk | 06/07/2012 | 06/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 003183IN | X | 800 | N PRYOR ST | Yard-Back | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 4 |
| Holmes Run | 003185IN | X | 706 | N PRYOR ST | Yard-Back | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 |
| Holmes Run | 003202IN | X | 5201 | TANEY AV | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 50 | 50 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------|-----------------|---------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 003206IN | X | 741 | N PEGRAM ST | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003207IN | X | 701 | N PEGRAM ST | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 26 | 26 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003214IN | X | 5111 | SUTTON PL | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003215IN | X | 611 | N PEGRAM ST | Sidewalk | 05/18/2012 | 05/18/2012 | Truck 1 | 1 | | 26 | 26 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003237IN | X | 5308 | TANEY AV | Sidewalk | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003277IN | X | 702 | N PELHAM ST | Sidewalk | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 15 | 15 | 0 | 0 | 1 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003282IN | X | 5350 | TANEY AV | Sidewalk | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003285IN | X | 5401 | TANEY AV | Sidewalk | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 4 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|--------------------------------|--|-------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003292IN | X | 701 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 53 | 53 | 0 | 0 | 4 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003303IN | X | 602 | N RIPLEY ST | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 53 | 53 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003321IN | X | 5501 | HOLMES RUN PY | Light Highway Rural Streets | 05/14/2012 | 05/14/2012 | Truck 1 | 1 | | 59 | 60 | 0 | 0 | 5 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 003329IN | X | 420 | N VAN DORN ST | Sidewalk | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 76 | 76 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Extreme: >50% mat'l loss, >3/4" (2cm) etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 003340IN | X | 5500 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|--------------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 003344IN | X | 5401 | TANEY AV | Light Highway Rural Streets | 05/16/2012 | 05/16/2012 | Truck 1 | 1 | | 65 | 65 | 5 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 003364IN | X | 901 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 003367IN | X | 901 | A TANEY AV | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 55 | 53 | 2 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Bench | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-3 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 003368IN | X | 5331 | A TANEY AV | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 53 | 53 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 003373IN | X | 789 | N VAN DORN ST | Light Highway Rural Streets | 05/09/2012 | 05/09/2012 | Truck 1 | 1 | | 73 | 66 | 50 | 0 | 4 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Channel | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | | Structural | | | | | | |
| | | | | Channel | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Channel | Debris/deposition | Extreme: >5 gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 003813IN | X | 4907 | RUTLAND PL | Sidewalk | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 003817IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 65 | 66 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Pipe Connection-2 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 003820IN | X | 175 | DUKE ST | Sidewalk | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 003821IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 52 | 50 | 2 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | | Structural | | | | | | |
| Holmes Run | 003822IN | X | 301 | N PAXTON ST | Sidewalk | 05/24/2012 | 05/24/2012 | Truck 1 | 1 | | 53 | 54 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|---------------|-------------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Pipe Connection-1 | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Pipe Connection-2 | Pipe cracked | Mod: 1/16" to 1/8" (2-3mm) width | | Structural | | | | | | |
| Holmes Run | 003826IN | X | 5340 | HOLMES RUN PY | Sidewalk | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003827IN | X | 301 | N PAXTON ST | Sidewalk | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003829IN | X | 5340 | HOLMES RUN PY | Sidewalk | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 003846IN | X | 486 | N OWEN ST | Yard-Back | 05/29/2012 | 05/29/2012 | Truck 1 | 1 | | 51 | 52 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003853IN | X | 101 | RIPLEY ST N | Parking Lot | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 43 | 38 | 15 | 0 | 1 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 003854IN | X | 101 | DUKE ST | Parking Lot | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|---------------|-----------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003855IN | X | 5340 | DUKE ST | Parking Lot | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003856IN | X | 101 | DUKE ST | Parking Lot | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003857IN | X | 5300 | HOLMES RUN PY | Sidewalk | 05/23/2012 | 05/23/2012 | Truck 1 | 1 | | 45 | 46 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003875IN | X | 5125 | DUKE ST | Parking Lot | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 70 | 61 | 35 | 0 | 4 |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Bench | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Bench | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 003878IN | X | 175 | PAXTON ST N | Parking Lot | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 003899IN | X | 5100 | SUTTON PL | Yard-Back | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 40 | 40 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 003901IN | X | 501 | N PEGRAM ST | Sidewalk | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 003902IN | X | 5109 | N PICKETT ST | Sidewalk | 05/17/2012 | 05/17/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003906IN | X | 200 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 65 | 66 | 0 | 0 | 2 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 003908IN | X | 301 | N RIPLEY ST | Sidewalk | 05/22/2012 | 05/22/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------|--------------------------------|---------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 003913IN | X | 5425 | N RIPLEY ST | Sidewalk | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003914IN | X | 5425 | DUKE ST | Sidewalk | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003919IN | X | 100 | RIPLEY ST N | Light Highway Rural Streets | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003927IN | X | 200 | N RIPLEY ST | Easement | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 1 |
| | | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003936IN | X | 5125 | DUKE ST | Sidewalk | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 42 | 43 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Mortar missing | Min: <10% of area | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003937IN | X | 5205 | DUKE ST | Sidewalk | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 56 | 38 | 35 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Channel | Debris/deposition | Maj: 3-5gal bucket | | Maintenance | | | | | | |
| Holmes Run | 003942IN | X | 5205 | DUKE ST | Alley | 06/11/2012 | 06/11/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | |
| | | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|--------------|---------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chimney/Shaft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chimney/Shaft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003946IN | X | 5140 | DUKE ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003947IN | X | 101 | S PICKET ST | Driveway | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 003948IN | X | 5150 | DUKE ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | No Access | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003953IN | X | 5311 | DUKE ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003954IN | X | 5220 | DUKE ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 003958IN | X | 5311 | DUKE ST | Parking Lot | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 003959IN | X | 5350 | DUKE ST | Sidewalk | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 003960IN | X | 30 | S REYNOLD ST | Sidewalk | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|---------------------------|--|----------------------------|-------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 003961IN | X | 5412 | DUKE ST | Sidewalk | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 48 | 45 | 5 | 0 | 2 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | Maintenance | | | | | | | |
| Holmes Run | 003971IN | X | 30 | S REYNOLD ST | Sidewalk | 06/20/2012 | 06/20/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 004053SMH | X | 1461 | N BEAUREGARD ST | Easement | 07/11/2012 | 07/11/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| Holmes Run | 004054SMH | X | 1121 | SEMINARY RD | Easement | 06/14/2012 | 06/14/2012 | Truck 1 | 1 | | 61 | 60 | 5 | 0 | 3 |
| | | | | Chimney/Shelf | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shelf | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | | |
| | | | | Channel | Debris/deposition | Min: <1gal bucket | | Maintenance | | | | | | | |
| Holmes Run | 004056SMH | X | 5340 | HOLMES RUN PY | Parking Lot | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 70 | 71 | 0 | 0 | 3 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | Structural | | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching ~ 3/8" (1cm) | | Structural | | | | | | | |
| | | | | Chimney/Shelf | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|-----------|----------------|----------|-----------------|--------------------------------|--|----------------------------|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chimney/Shft | Cracked | Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 004058SMH | X | 4601 | STRATHBLANE PL | Yard-Back | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 18 | 19 | 0 | 0 | 2 |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 004059SMH | X | 903 | JUNIPER PL | Parking Lot | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 62 | 63 | 0 | 0 | 5 |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chimney/Shft | Mortar missing | Min: <10% of area | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 004063SMH | X | 2000 | BEAUREGARD ST N | Light Highway Rural Streets | 08/17/2012 | 08/17/2012 | Truck 1 | 1 | | 56 | 57 | 0 | 0 | 2 |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | | Structural | | | | | | |
| | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 004066IN | X | 25 | S PICKETT ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 60 | 55 | 30 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Pipe Connection-1 | Roots Intrusion | Maj: 1/8"-3/16" (3-5mm) dia. fingers, 3/8"-3/4" (1-2cm) runners, tap root, | | | Maintenance | | | | | | |
| Holmes Run | 004068IN | X | 25 | S PICKET ST | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 2 | 0 | 2 | 0 | 2 |
| | | | | Bench | Debris/deposition | Min: <1gal bucket | | | Maintenance | | | | | | |
| Holmes Run | 004069IN | X | 25 | S PICKETT ST | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |
| Holmes Run | 004073IN | X | 25 | S PICKET ST | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| Holmes Run | 004077IN | X | 5150 | DUKE ST | Sidewalk | 06/19/2012 | 06/19/2012 | Truck 1 | 1 | | 37 | 37 | 0 | 0 | 3 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 004079IN | X | 50 | S PICKET ST | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 54 | 55 | 0 | 0 | 3 |
| | | | | Frame Base Seal | Cracked / deteriorated | Mod: 1/16"-3/8" (2-10mm) width, small pieces | | | Structural | | | | | | |
| | | | | Frame Base Seal | Corroded, pitted, spalled | Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 004251IN | X | 5801 | DUKE ST | Sidewalk | 07/23/2012 | 07/23/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 4 |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| Holmes Run | 004325IN | X | 6130 | N BRECKINRIDGE PL | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes | | | | | | | | | | | | | | | |
|---|---------------------------|--|------------|-------------------|-------------|----------------------------|----------------------------|---------|--------|-------------------|------------------|--------------------|----------------|----------------------------|--------------------|---------|---------------------------|--|------------|--|---------|---------------------------|--|------------|--|---------|---------------------------|--|------------|--|
| Holmes Run | 004330IN | X | 201 | N BRECKINRIDGE PL | Easement | 07/24/2012 | 07/24/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 3 | | | | | | | | | | | | | | | |
| Holmes Run | 004664IN | X | 6130 | LINCOLNIA RD | Sidewalk | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | Debris | 0 | 0 | 0 | 0 | 0 | | | | | | | | | | | | | | | |
| Holmes Run | 004665IN | X | 479 | N MORGAN ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 | | | | | | | | | | | | | | | |
| Holmes Run | 004666IN | X | 5498 | N MORGAN ST | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Chamber</td> <td style="width: 10%;">I/I evidence</td> <td style="width: 80%;">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td style="width: 10%;">I/I</td> <td style="width: 10%;"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004667IN | X | 5498 | N MORGAN ST | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004668IN | X | 1221 | N MORGAN ST | Parking Lot | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004669IN | X | 1221 | N MORGAN ST | Parking Lot | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004672IN | X | 5400 | N MORGAN ST | Parking Lot | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Mod: 1/16" to 1/8" (2-3mm) width, small pieces</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004675IN | X | 520 | N ARMISTEAD ST | Sidewalk | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 4 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td>Mod: 1/16" to 1/8" (2-3mm) width, small pieces</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td>Min: <10% mat'l loss, etching</td> <td>Structural</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Holmes Run | 004676IN | X | 520 | N ARMISTEAD ST | Sidewalk | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 | | | | | | | | | | | | | | | |
| <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td>Chamber</td> <td>Cracked</td> <td>Mod: 1/16" to 1/8" (2-3mm) width, small pieces</td> <td>Structural</td> <td></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td></td> </tr> </table> | | | | | | | | | | | | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | |
| Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | Structural | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | I/I | | | | | | | | | | | | | | | | | | | | | | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-------------------|---------------------------|--|----------------------------|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 004678IN | X | 5925 | QUANTRELL AV | Sidewalk | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 55 | 56 | 0 | 0 | 3 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Bench | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Bench | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 004679IN | X | 705 | QUANTRELL AV | Sidewalk | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 49 | 45 | 10 | 0 | 3 |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Pipe Connection-1 | Roots Intrusion | Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small mass | | | Maintenance | | | | | | |
| Holmes Run | 004688IN | X | 6130 | LINCOLNIA RD | Driveway | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 99 | 99 | 0 | 0 | 4 |
| | | | | Cover | Cracked / deteriorated | Extreme: separating into pieces | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 004689IN | X | 301 | BEAUREGARD ST N | Driveway | 08/14/2012 | 08/14/2012 | Truck 1 | 1 | | 50 | 51 | 0 | 0 | 2 |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chimney/Shft | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chimney/Shft | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | | Structural | | | | | | |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| Holmes Run | 004690IN | X | 6130 | N BRECKINRIDGE PL | Sidewalk | 06/18/2012 | 06/18/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | | Structural | | | | | | |
| | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | | Structural | | | | | | |
| | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | | I/I | | | | | | |
| Holmes Run | 004705IN | X | 6000 | LINCOLNIA RD | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|----------------|-----------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004708IN | X | 6000 | QUANTRELL AV | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 48 | 49 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004709IN | X | 5851 | QUANTRELL AV | Parking Lot | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 004710IN | X | 5851 | QUANTRELL AV | Parking Lot | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 50 | 50 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Mod: 1-3gpm, trickle, flow dripping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Mod:10-25% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004718IN | X | 5750 | QUANTRELL AV | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 004719IN | X | 6000 | QUANTRELL AV | Sidewalk | 05/04/2012 | 05/04/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 004726IN | X | 5851 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | No Access | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 004752IN | X | 5400 | N ARMISTEAD ST | Yard-Back | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004753IN | X | 5400 | N ARMISTEAD ST | Parking Lot | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|-------------|----------------------------|--|---------|------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 004754IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 004755IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004756IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 004757IN | X | 435 | N ARMISTEAD ST | | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | Not found | 0 | 0 | 0 | 0 | 0 |
| Holmes Run | 004758IN | X | 435 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 004759IN | X | 5851 | N ARMISTEAD ST | Easement | 07/17/2012 | 07/17/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 4 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 004775IN | X | 301 | N BEAUREGARD ST | Sidewalk | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| Holmes Run | 004781IN | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 3 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|---------------|-----------------|----------------------------|--|---------|-------------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| Holmes Run | 004784IN | X | 5925 | QUANTRELL AV | Yard-Side | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 44 | 45 | 0 | 0 | 2 |
| | | | | | Chamber | Cracked | Mod: 1/16" to 1/8" (2-3mm) width, small pieces | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| Holmes Run | 004785IN | X | 5925 | QUANTRELL AV | Parking Lot | 05/07/2012 | 05/07/2012 | Truck 1 | 1 | | 37 | 38 | 0 | 0 | 2 |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 004786IN | X | 723 | ASHTON ST N | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 15 | 0 | 15 | 0 | 1 |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 004787IN | X | 723 | ASHTON ST N | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 15 | 0 | 15 | 0 | 2 |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 004788IN | X | 705 | ASHTON ST N | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 15 | 0 | 15 | 0 | 3 |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 004789IN | X | 705 | ASHTON ST N | Sidewalk | 10/18/2012 | 10/18/2012 | Truck 1 | 1 | | 15 | 0 | 15 | 0 | 1 |
| | | | | | Channel | Debris/deposition | Mod: 1-3gal bucket | | Maintenance | | | | | | |
| Holmes Run | 009060IN | X | 5340 | HOLMES RUN PY | Parking Lot | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 009062IN | X | 5340 | HOLMES RUN PY | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 42 | 42 | 0 | 0 | 3 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| | | | | | Chamber | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | |
| | | | | | Chamber | Corroded, pitted, spalled | Min: <10% mat'l loss, etching | | Structural | | | | | | |
| | | | | | Chamber | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |
| Holmes Run | 009064IN | X | 486 | OWEN ST N | Yard-Back | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 40 | 40 | 0 | 0 | 2 |
| | | | | | Frame Base Seal | Cracked / deteriorated | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | |

| Basin | MH | SCREAM Insp | Building | Address | Location | Date | Alternate Link | Crew | Status | Why Not Inspected | Overall MH Score | MH Struct II score | MH Maint Score | MH Pot II Field Flow (gpm) | # Connecting Pipes |
|------------|----------|----------------|----------|-----------------|---------------------------|--|----------------------------|-------------|--------|----------------------|---------------------|-----------------------|-------------------|----------------------------------|--------------------------|
| Holmes Run | 009077IN | X | 5008 | Frame Base Seal | Corroded, pitted, spalled | Min: <10% mat'l loss, <3/8" (1cm) etching | | Structural | | | | | | | |
| | | | | Frame Base Seal | I/I evidence | Min: <1/4gpm, staining, mineral deposits, flow weeping | | I/I | | | | | | | |
| | | | | Chimney/Shft | Cracked | Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling | | Structural | | | | | | | |
| Holmes Run | 009077IN | X | 5008 | GARDNER DR | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 50 | 0 | 50 | 0 | 2 |
| | | | | Channel | Debris/deposition | Extreme: >5 gal bucket | | Maintenance | | | | | | | |
| Holmes Run | 009080IN | X | 4510 | DUKE ST | Sidewalk | 10/19/2012 | 10/19/2012 | Truck 1 | 1 | | 0 | 0 | 0 | 0 | 2 |

Appendix C – Summary of Structures Not Inspected

| Facility ID | Why Not Inspected |
|-------------|-----------------------------------|
| 001012SMH | Not Inspected - Buried and Marked |
| 004664IN | Not Inspected - Debris |
| 000162IO | Not Inspected - No Access |
| 000229ND | Not Inspected - No Access |
| 000272ND | Not Inspected - No Access |
| 003948IN | Not Inspected - No Access |
| 004726IN | Not Inspected - No Access |
| 001500SMH | Not Inspected - No Access |
| 002253IN | Not Inspected - No Access |
| 000144IO | Not Inspected - Not found |
| 000671SMH | Not Inspected - Not found |
| 000760SMH | Not Inspected - Not found |
| 000767SMH | Not Inspected - Not found |
| 000769SMH | Not Inspected - Not found |
| 000779SMH | Not Inspected - Not found |
| 000890SMH | Not Inspected - Not found |
| 000901SMH | Not Inspected - Not found |
| 000956SMH | Not Inspected - Not found |
| 001048SMH | Not Inspected - Not found |
| 001049SMH | Not Inspected - Not found |
| 001242SMH | Not Inspected - Not found |
| 001909IN | Not Inspected - Not found |
| 002727IN | Not Inspected - Not found |
| 002746IN | Not Inspected - Not found |
| 004665IN | Not Inspected - Not found |
| 004757IN | Not Inspected - Not found |
| 000653SMH | Not Inspected - Other |
| 000778SMH | Not Inspected - Other |
| 001371SMH | Not Inspected - Other |
| 003135IN | Not Inspected - Sealed Lid |
| 003136IN | Not Inspected - Sealed Lid |
| 000145IO | Not Inspected - Surcharge |

Appendix D - Summary of Observed Pipe Defects

SCREAMTM Lamping - Summary of Observed Defects

Alexandria - Holmes Run

| Pipe | SCREAM Total Score | USMH Bldg | MH Street | Observed | | Inventory | Maintenance | Structural | | | |
|---------------------|--------------------|-----------|-----------------|--------------|----------------------|-----------|-------------|------------|---------------|-------|------------|
| | | | | Infiltration | Infiltration (Count) | | | Roots | Broken pieces | Crack | Displaced |
| | | | | | | | | | | | Open Joint |
| 001500SMH-001505SMH | 13 | 205 | BRECKINRIDGE PL | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000937SMH-000934SMH | 13 | 504 | OWEN ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000929SMH-000931SMH | 13 | 503 | NAYLOR ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 002641IN-000951SMH | 13 | 501 | PICKETT ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000923SMH-000931SMH | 13 | 4801 | TANEY AV | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000653SMH-000654SMH | 13 | 5703 | RAYBURN AV | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 001505SMH-001507SMH | 13 | 205 | BRECKINRIDGE PL | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 002880ND-001962IN | 13 | 5683 | RAYBURN AV | 1 | 1 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000950SMH-000951SMH | 13 | 509 | PICKETT ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 002803IN-002817IN | 13 | 6030 | MORGAN ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 002817IN-000981SMH | 13 | 6030 | MORGAN ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 003367IN-003364IN | 13 | 901 | VAN DORN ST | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 001961IN-000656SMH | 13 | 5697 | RAYBURN AV | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 001985IN-001982IN | 13 | 5612 | HARDING AV | 1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 002801IN-002803IN | 20 | 6040 | MORGAN ST | 2 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 003368IN-003367IN | 20 | 5331 | TANEY AV | 2 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000931SMH-000930SMH | 20 | 4806 | TANEY AV | 2 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 000510SMH-000509SMH | 25 | 2323 | CHAMBLISS ST | 0 | 0 | 0 | 0 | 0 | 0 | 1 | 0 |
| 004545IN-001454SMH | 25 | 4550 | PEGRAM ST | 0 | 0 | 0 | 0 | 0 | 0 | 1 | 0 |
| 000961SMH-000962SMH | 32 | 4500 | PEACOCK AV | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 004680IN-004679IN | 32 | 705 | ASHTON ST | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 002017IN-002008IN | 40 | 1459 | BEAUREGARD ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 001953IN-001952IN | 40 | 5650 | RAYBURN AV | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 000669SMH-000662SMH | 40 | 5703 | RAYBURN AV | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 002562IN-002828IN | 40 | 1121 | HOWARD ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 002800IN-002801IN | 40 | 6040 | MORGAN ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 002693IN-000964SMH | 40 | 800 | JORDAN ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 003822IN-001223SMH | 40 | 301 | PAXTON ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 002195IN-000747SMH | 40 | 4600 | DUKE ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 000654SMH-000669SMH | 40 | 5703 | RAYBURN AV | 0 | 0 | 0 | 0 | 0 | 8 | 0 | 0 |
| 001952IN-001956IN | 40 | 5650 | RAYBURN AV | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 001950IN-001952IN | 40 | 5650 | RAYBURN AV | 0 | 0 | 0 | 0 | 0 | 8 | 0 | 0 |
| 002198IN-002195IN | 40 | 4600 | DUKE ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 002563IN-002562IN | 40 | 1121 | HOWARD ST | 0 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 000948SMH-000949SMH | 45 | 607 | PICKETT ST | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 000947SMH-000948SMH | 45 | 609 | PICKETT ST | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 001223SMH-003817IN | 48 | 301 | PAXTON ST | 1 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 003821IN-003822IN | 48 | 301 | PAXTON ST | 1 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 003844IN-001248SMH | 48 | 484 | OWEN ST | 1 | 0 | 0 | 0 | 0 | 4 | 0 | 0 |
| 004778IN-001527SMH | 53 | 5925 | QUANTRELL AV | 0 | 0 | 0 | 0 | 1 | 0 | 0 | 0 |
| 004060IN-004066IN | 65 | 5250 | VALLEY FORGE DR | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 002982IN-000999SMH | 90 | 5407 | WYCKLOW CT | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| 003857IN-000274IQ | 92 | 5300 | HOLMES RUN PY | 0 | 0 | 4 | 0 | 0 | 0 | 0 | 2 |
| 002802IN-002803IN | 100 | 6021 | MORGAN ST | 1 | 0 | 4 | 0 | 0 | 0 | 0 | 0 |
| Total | | | | 24 | 35 | 32 | 1 | 72 | 2 | 2 | |

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.